

MAS003517 RU 23-06

RAPID UPDATE

FROM: Maserati TSO

TO: Maserati Network



Maserati

PERSONAL SERVICE LAB

MASTERS OF CARE

Rapid Update 611 MC20 – steering column control stuck (OPT SBE)

TECHNICAL SERVICE OPERATIONS



DATE: MARCH 28 2023

Certain Maserati MC20 (M240) MY23 listed in MODISCS+ are involved in a Rapid Update to check the operating function of the power tilt/telescopic steering column.

This action is needed to verify the correct functionality of the power tilt/telescopic steering column which in some cases could get stuck during operation.

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before starting the procedure.
Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions. (Maseratitechsupport@maserati.com)

Thank You for your continued support and cooperation.

Maserati Americas
Aftersales Dept.

Technical Procedure

 All images shown in this bulletin are for illustrative purposes only

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. Switch the Ignition to the "ON" position.
3. Use the "power tilt/telescoping steering column/wheel switch" to operate the power tilt/telescopic steering column in the following sequence below:



- a. 3 UP activations
- b. 3 DOWN activations
- c. 3 SLIDE FORWARD activations
- d. 3 SLIDE BACK activations

For each activation and each position, please check the following conditions:

- An acoustic "click" must be audible.
- At the end of the action, the button must return to the base or resting position.
- The steering wheel movement must stop when releasing the button.

4. Switch the Ignition "OFF".
5. If all the conditions are satisfied for all the activations, the **check is OK**, no further operation is needed, the procedure is complete.
6. If at least one of the conditions is not verified for one or more activations, the **check is NOT OK** and the component must be replaced, following the procedure below (available in the workshop manual):
 - a. **8.50.055.0 - STEERING COLUMN ADJUSTMENT CONTROL - Removal/refitting or replacement**
7. Operation is complete.

Spare Parts

Spare parts	PN	QTY
STEERING COLUMN ADJUSTMENT CONTROL	670265777	1

Warranty Claim

Fill in the relative Warranty Claims as follows:

Description	Code
Campaign Number	611
Warranty Code	23
Fault Code	063
Component Code	8.50.055
Operation Code	
<ul style="list-style-type: none"> ▪ Check ▪ Replacement 	8.50.055.A (0,05 h) 8.50.055.0 (0,15 h)