Technical Service Bulletin



20 EVAP charcoal filter line (valve) - noise in rear of passenger compartment (tocking, ticking) - V6 TFSI 20 23 58 2070153/1 April 25, 2023.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6, A6 allroad, S6, A7, and S7	2020 – 2024	All	Not Applicable

Condition

Customer states:

- Ticking and/or thumping noises can be heard, primarily when sitting in the right rear seat.
- · The noises mostly occur at idling speed.

Workshop findings:

 The activated charcoal filter solenoid (N80) vibrates the activated charcoal filter line; this results in a ticking and/or thumping noise.

Technical Background

The activated charcoal filter solenoid (N80) valve vibrates the activated charcoal filter line; this results in a ticking and/or thumping noise.

Production Solution

Not Applicable

Service

- 1. Remove the wheel housing liner.
- 2. Install 11 sleeves 4KD 201 255 according to ETKA on the activated charcoal filter line (figure 1 b) in the area of the wheel housing liner (figure 1c).
 - a. Please ensure that no lines are pressed, crushed, or put under tension when you fit the parts.



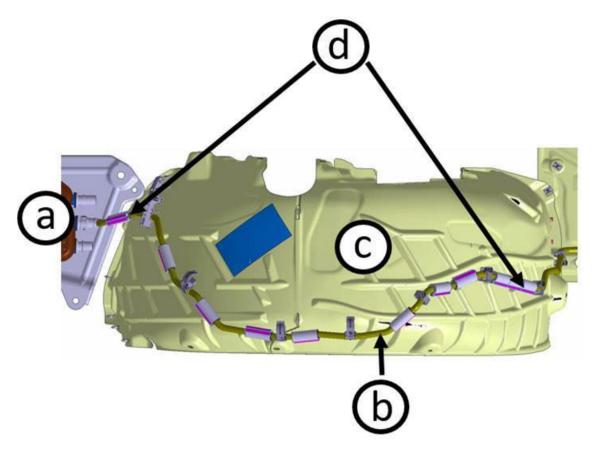


Figure 1: Position of the sleeves (view from above).

Technical Service Bulletin



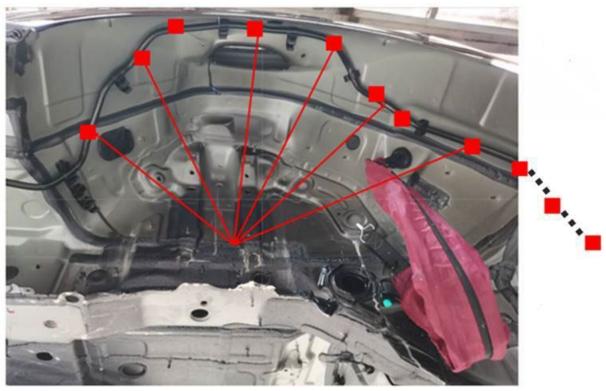


Figure 2: The activated charcoal filter line in the wheel housing (view from below with the wheel housing liner removed). The sleeves are represented by red squares.

Warranty

_	T				
Claim Type:	• 110 Up to 48 Months/50,000 Miles.				
	G10 for CPO Covered Vehicles – Verify Owner.				
	If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.				
Service Number:	2024				
Damage Code:	0020				
Labor Operations:	Remove and install rear wheel housing liner	6676 1900	See SRT with associated operations		
	Repair activated charcoal filter line	2022 4199	20 TU		
Diagnostic Time:	GFF	No allowance	0 TU		

Page 3 of 4

© 2023 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

Technical Service Bulletin



Claim Comment:	As per TSB 2070153/1
----------------	----------------------

Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.					
Part Number	Part Description	Quantity			
4KD.201.255	Sleeve	11			

Additional Information

All parts and service references provided in this TSB (2070153) are subject to change and/or removal.

©2023 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.