

87-23-02TT - A/C Compressor Fault - U032A00: Software Incompatibility With Rel A/C Compressor

Release date:

Transaction No:

4/20/2023

# Condition

#### **ATTENTION:**

THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN.

TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.

Applicable Vehicles							
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To		
ID.4	2021	All	All	All	All		

Revision Table						
Instance Number	Published Date	Version Number	Reason For Update			
2070000/1	4/20/23	87-23-02TT	Original publication.			

# **Technical Background**

If the air conditioning is currently inoperative and accompanied by fault U32A00, do not replace the A/C compressor or the control module. Confirm if the 97ZZ campaign needs to be performed.

### **Service**

In ElsaPro/Elsa2Go check the status of the 97ZZ service campaign.

Check the software level according to the Appendix A software table.

Diagnostic Address	New Part Number	New Software Version
0008	1EA907727S , 1EA907727T	0425

If the update has already been performed further diagnosis is required. Perform the A/C compressor calibration test and clear any faults and verify the A/C is then operational and resolved.

# **Additional Information**

© 2023 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.