



## SIB 84 14 22

2023-03-24

### GPS LOCATION DISPLAY IS INCORRECT IN VEHICLE

This Service Information Bulletin (Revision 1) replaces SI B84 14 22 **dated December 2022**.

#### What's New (Specific text highlighted):

- Revised Procedure section
- Revised defect code in Claim section

## MODEL

F44 (2 Series Gran Coupe)	F90 (M5 Sedan)	F91 (M8 Convertible)	F92 (M8 Coupe)
F93 (M8 Gran Coupe)	F95 (X5 M Sports Activity Vehicle)	F96 (X6 M Sports Activity Coupe)	F97 (X3 M Sports Activity Vehicle)
F98 (X4 M Sports Activity Coupe)	G01 (X3 Sports Activity Vehicle)	G02 (X4 Sports Activity Coupe)	G05 (X5 Sports Activity Vehicle)
G06 (X6 Sports Activity Coupe)	G07 (X7 Sports Activity Vehicle)	G09 (XM Sports Activity Vehicle)	G12 (7 Series Sedan)
G14 (8 Series Convertible)	G15 (8 Series Coupe)	G16 (8 Series Gran Coupe)	G20 (3 Series Sedan)
G22 (4 Series Coupe)	G23 (4 Series Convertible)	G26 (4 Series Gran Coupe)	G29 (Z4 Roadster)
G30 (5 Series Sedan)	G32 (640i xDrive Gran Turismo)	G42 (2 Series Coupe)	G80 (M3 Sedan)
G82 (M4 Coupe)	G83 (M4 Convertible)		

## SITUATION

Customer is shown an incorrect GPS location in the vehicle (i.e., Nav Map, coordinates).

## CAUSE

Unfavorable software in the telematics control unit (ATM-02).

## CORRECTION

Program the telematics control unit (ATM-02).

## PROCEDURE

Determine what is the vehicle's current electrical system integration level (I-level) by either using AIR/ISPA NEXT/AWP (Aftersales Workplace) applications.

Is the current I-level lower than I-Level 22-11-530?

- **Yes** – Proceed to the next step and update the vehicle software
- **No** – Continue with standard troubleshooting

Program the vehicle to I-level 22-11-530 or higher using ISTA 4.38.2 (released mid-Nov. 2022) or higher.

- Connect the battery charger to the vehicle
- Connect the programming system to the vehicle (ISTA 4)
- Determine measures plan
- Accept and fully work through the measures plan with the control units to be programmed/encoded and enabled
- Follow the rework list
- **Depending on the rework list, carry out a vehicle test and delete the fault memory if needed**

After the programming has been fully completed, check functionality of the system.

Note: ISTA will automatically reprogram and code all programmable control modules that do not have the latest software.

**Always connect a BMW-approved battery charger/power supply (SIB 04 23 10).**

For information on programming and coding with ISTA, refer to Dealer Universal Portal / TIS / Technical Documentation / Diagnostics and Programming / Programming Documentation.

## **CLAIM INFORMATION**

During this workshop visit, the affected vehicle may show one or more programming and encoding Technical Campaign repairs open, the programming and encoding procedure may only be invoiced one time.

**Select one of these open Technical Campaigns to perform and submit for updating the vehicle's software to the required I-level or higher.**

**Please be sure to perform any additional before and/or after work (including attaching labels) as required by the open campaigns on the vehicle. Close any remaining open programming and encoding Campaign repairs as outlined in the corresponding Service Information Bulletin.**

Only if the above situation does not apply, the BMW software solution is then:

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks or the BMW Certified Pre-Owned Program.

<b>Defect Code:</b>	<b>6525241200</b>	<b>GPS reception through aerial Permanent failure</b>
---------------------	-------------------	---

Refer to AIR for the corresponding flat rate unit (FRU) allowances.

<b>Labor Operation</b>	<b>Description</b>	<b>Labor Allowance</b>
00 00 006	Performing vehicle test (with vehicle diagnosis system – checking faults) (Main work)	Refer to AIR
Or:		
00 00 556	Performing vehicle test (with vehicle diagnosis system – checking faults) (Plus work)	Refer to AIR
And:		
61 21 528	Support voltage of the vehicle electrical system / recharge vehicle electrical system battery	Refer to AIR
And, as necessary:		
61 00 006*	Performing vehicle diagnosis – test module (Work time)	WT
Or		
00 58 500*	Diagnosis Worktime Flat Rate (See below)	2 FRU
And		
61 00 730	Programming/encoding control unit(s)	Refer to AIR

If you are using a Main labor code for another repair, use the Plus code labor operation 00 00 556 instead of 00 00 006, or exclude (including 61 21 528) when the Vehicle Test is included in another repair.

Work time labor operation codes 61 00 006 and 00 58 500 are not considered Main labor operations.

## **Programming and Encoding - Vehicle Control Units (RO and Claim Comments Required)**

This procedure automatically reprograms and encodes any vehicle control modules that do not have the latest software.

Copyright ©2023 BMW of North America, Inc.

If one or more control modules fail during the reprogramming procedure, claim the required consequential repair work procedures to address this issue (including performing the IRAP Control Unit Recovery first as required, refer to the SIB in AIR) under the Defect Code in this bulletin with the labor operations in AIR that apply.

Please explain the additional work procedures that were performed (The why and the what) on the repair order and in the claim comments.

For covered repairs that address control module failures that occurred prior to performing this reprogramming procedure, claim this work with the Defect Code and labor operations (including the diagnosis that applies\*) in AIR that apply.

\*Based on which one applies to your center, please refer to **SI B01 01 20** or **B01 07 20** for the applicable procedure for documenting, claiming, and explaining, on the RO and in the claim comments, your diagnosis work time (WT), job/repair work time (WT), and the vehicle repairs your center performed, unless otherwise required by State law.

## FEEDBACK REGARDING THIS BULLETIN

Technical Feedback	To submit feedback for the technical topics of this bulletin: Submit your feedback in the rating box at the top of this bulletin
Warranty Feedback	To submit feedback for the CLAIMS section of this bulletin: Submit an IDS ticket to the Warranty Department, or use the chat available in the Warranty Documentation Portal
Parts Feedback	To submit feedback for the PARTS section of this bulletin: Submit an IDS ticket to the Parts Department

