

5. See Figure 3. For oil pumps with manufacturing dates in February 2023, lay a straight edge across the gerotors and the oil pump face.
 - a. If the gerotor faces are projecting slightly higher from face of the oil pump, then the pump is defective.

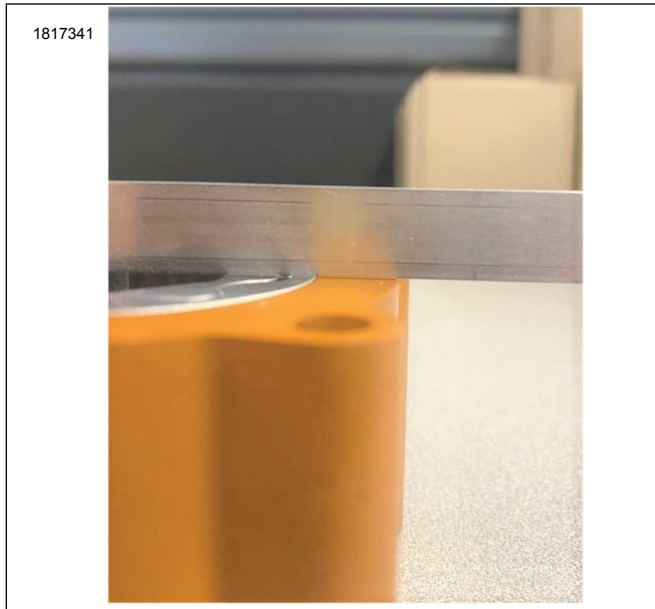


Figure 3. Straight End

Credit Procedure

NOTE

Enter service bulletin number M1586 into Events Comments section of claim.

Do not use a Vehicle Identification Number (VIN) when submitting these claims.

Submit a warranty claim per the Table 4 below for all kits in dealer stock that are mismanufactured. Submit a separate event for each individual part number.

Table 4. Talon and H-DNET Warranty Claim System Users

ITEM	DATA
Claim Type	DFS
Problem Part Number	62400261 or 62400266
Quantity	Could vary
Customer Concern Code	9203
Condition Code	2105

Submit a warranty claim per the Table 5 below for all kits in dealer stock that are mismanufactured. Submit a separate claim for each individual part number.

Table 5. GDP Warranty Claim System Users

ITEM	DATA
Claim Type	PAM claim-stock
Problem Part Number	62400261 or 62400266
Quantity	Could vary
Customer Concern Code	9203
Condition Code	2105