

SSM 51576

2023 Bronco Sport (CX430) (HD)

2023 Bronco Sport Warning Message Displayed In The IPC
Indicating Rear Park Aid Not Available Sensor Blocked See
Manual

Some 2023 Bronco Sport vehicles built on 20-Dec-2022 and through 16-Jan-2023 may exhibit a warning message displayed in the instrument panel cluster (IPC) indicating Rear Park Aid Not Available Sensor Blocked See Manual. This may be to inner/outer rear parking aid sensors malfunction. To correct this condition, replace the inner/outer rear parking aid sensors and paint-to-match as required. For inner parking aid sensors use part number JU5Z-15K859-ABW and for outer parking aid sensors use part number KU5Z-15K859-AAPT. Refer to the Workshop Manual (WSM), Section 413-13A > Parking Aid > Removal and Installation. For claiming use causal part number 15K859 and applicable labor operations in Sections 10 and 13 of the Service Labor Time Standards (SLTS) Manual.