



## **SERVICE BULLETIN**

**SB-23-001 S-SERIES P22FB/P22FE DCU  
CALIBRATION UPDATE**

**GROUP: ENGINE  
BULLETIN NO: SB-23-001  
DATE: 4-20-2023  
REF: SB22-L-001**

**Subject:** 2022-2023 MY Hino S Series Vehicles equipped with 5.2L (4HK1) Diesel Engines and Option (IE1) 4 Wheel Disc Brakes

**Note:** This technical service bulletin is provided as technical information and is not authorization for a warrantable repair.

## **INFORMATION:**

The vehicle's Malfunction Indicator Lamp (MIL) may illuminate with DTC P22FB and/or P22FE set in the DEF Control Unit (DCU). If one or more of the preceding DTCs are present, first follow the diagnostic for the DTC(s) in question. If no mechanical fault can be found during normal diagnosis, follow the service procedure in this bulletin to correct the concern.

## **SERVICE PROCEDURE**

If the calibration part number does NOT match the calibration number listed in the table below, reprogram the DCU with the latest software and calibration using the Isuzu Diagnostic Service System (IDSS) version 14.6.8 or later:

**Note:** If the calibration number IS listed, follow the Intermittent Conditions diagnostics in the appropriate Workshop Manual.



MY	Vehicle	Engine	Calibration #
2022	S Series	5.2L	97874372
2023	S Series	5.2L	97874373

## WARRANTY INFORMATION

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
L8002	CALI UPDATE REPRGM DCU P22FB/FE	0.4

