

Service Bulletin

INFORMATION

Subject: Information on Service Rear Axle Displayed on Drivers Information Center (DIC) - DTC C10A6, C10A7 and/or C1058 Set

Brand:	Model:	Model Year:		VIN:		Engine	Transmission:
		from	to	from	to	Engine:	fransmission.
Cadillac	Escalade Models	2021	2021				
Chevrolet	Suburban						
	Tahoe						
GMC	Yukon Models						

Involved Region or Country	gion or Country North America	
Condition	 Some customers may comment on one or more of the conditions: Service Rear Axle MIL illuminated Some technicians may find one or more of the following DTCs set in the Differential Control Module (DCM): C10A6: Axle Differential Lock Motor Temperature Sensor Signal C10A7: Axle Differential Lock Motor Position Sensor High Reference C1058: Axle Differential Lock Motor Position Sensor Signal 1 	
Cause	This condition may be caused by corrosion in the Differential Lock Motor/Limited Slip Differential Clutch Motor electrical connector and/or electrical harness.	
Information	If during inspection that damage or corrosion has been found, replacement of the wiring harness and Differential Lock Motor/Limited Slip Differential Clutch Motor may be required to prevent future water intrusion and eliminate impacts from corrosion.	

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Service Procedure

Refer to Wire and Connector Repair in SI.

Version	2			
Modified	Released October 15, 2021 Revised April 17, 2023 - Change RDM to Differential Control Module and added Differential Lock Motor/Limited Slip Differential Clutch Motor.			