



Service Bulletin


Bulletin No.: 22-NA-153

Date: May, 2023

TECHNICAL

Subject: Flutter Noise from Right Rear Corner of the Vehicle

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade Models	2021	2023	-	-	-	-
Chevrolet	Suburban Tahoe						
GMC	Yukon						

Involved Region or Country	North America, Middle East
Condition	Some customers may comment on a flutter type noise coming from the right rear corner of the vehicle.
Cause	The cause of the condition may be the Pressure Relief Valve (PRV). Note: This condition might be more prone to occur while towing a trailer.
Correction	<div style="text-align: center;">  </div> <p style="text-align: right;">6131341</p> <p>Replace the left and right Pressure Relief Valve with 4 flap design to prevent flapping while pulling trailer.</p>

Service Procedure

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

If you encounter a vehicle with the above concern, replace the pressure relief valve. Refer to *Body Pressure Relief Valve Replacement* in Si.

Parts Information

Causal Part	Description	Part Number	Qty
X	Pressure Relief Valve	22788177	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
1040050	Body Pressure Relief Valve Replacement	Use Published Labor Operation Time

Version	2
Modified	Released January 19, 2023 Revised May 04, 2023 — Added Note to Condition and updated Correction.

