



Slide out bulb seal and schwintek slide out motor

Bulletin Type:	TSB	Publication Date:	May 2023
Bulletin #(s):	23-100	Make(s):	Starcraft
Job Code(s):	9802518	Model(s):	Super Lite TT
Flat Rate(s):	0.50 Hr. Labor – Bulb Seal and Schwintek Motor Repair	Model Year(s):	2023

Incident:	Slide-out Water Leak
Affected Units:	2023 Starcraft Super Lite TT
Parts Kit:	Parts Kit #: 23-100
	1 - SEAL,BULB EXT 1.20 BLK D-SEAL SLIDE-IN MOTOR,SLO IN-WALL H TRQ
	1 - 500:1 LIPPERTS/SCHWINTEK
	1 - SEALANT,GEOCEL CLR 2300 VBS
Misc. Tools & Supplies:	Drill Bit
Parts Return Information:	N/A

Bulletin Type:	TSB	Publication Date:	May 2023
Bulletin #(s):	23-106	Make(s):	Highland Ridge
Job Code(s):	9804518	Model(s):	Range Lite
Flat Rate(s):	0.50 Hr. Labor – Bulb Seal and Schwintek Motor Repair	Model Year(s):	2023

Incident:	Slide-out Water Leak
Affected Units:	2023 Highland Ridge Range Lite
Parts Kit:	Parts Kit #: 23-100
	1 - SEAL,BULB EXT 1.20 BLK D-SEAL SLIDE-IN MOTOR,SLO IN-WALL H TRQ
	1 - 500:1 LIPPERTS/SCHWINTEK
	1 - SEALANT,GEOCEL CLR 2300 VBS
Misc. Tools & Supplies:	Drill Bit
Parts Return Information:	N/A

BULB SEAL INSPECTION

1. Proceed with the installation instruction if the larger bulb seal on the outside slide-out as shown by the red arrow in figure 1 is not present.

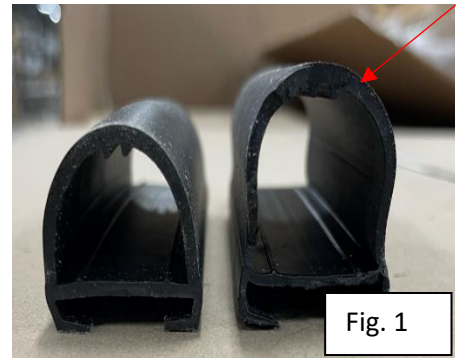


Fig. 1

BULB SEAL AND SCHWINTEK MOTOR REPLACEMENT INSTRUCTIONS

1. Remove top bulb seal and replace with larger bulb seal. Remember to put a bead of sealant across the top along the wall after replacing bulb seal. (Figures 2 and 3)
2. Change out slide-out Schwintek motor from the 300-1 to the 500-1. (Figure 4)
 - a. Begin by entering the unit and retracting the slideout. Remove the bulb seal as shown in Figure 5.
 - b. Locate the wire by pulling the rubber back and unplug it from the motor. Pull the motor out by tipping it out and then sliding down. Replace with new motor once you have removed the old motor. Reinstall rubber and bulb seal. (Figure 5 and 6)
 - c. Click the link (https://youtu.be/jNWAyb_dq1c) for more details on how the slide-out Schwintek is removed and replaced.



Fig. 2



Fig. 3



Fig. 4



Fig. 5



Fig. 6

Jayco's sole obligation under our limited warranty is to repair or replace defective materials and/or workmanship deemed our responsibility as determined by Jayco in our sole discretion. Jayco reserves the right to use new and/or remanufactured parts or materials of similar quality to complete any work, and to make parts and/or design changes as appropriate without notice to anyone. Jayco designs and/or materials changes are done without obligation to incorporate such changes in previously manufactured product. Jayco makes every reasonable effort to ensure field remedies will not adversely affect performance and/or safety of the unit. This field remedy is not intended to extend to future performance of this RV, or any of its materials, components or parts beyond the standard warranty period. The RV owner's obligation to notify Jayco, or one of its independent, authorized dealers, of a claimed defect does not modify any obligation placed on the RV owner to contact Jayco directly when attempting to pursue remedies under state or federal law.

903 South Main Street • P.O. Box 460 • Middlebury, IN 46540