



|        |  |
|--------|--|
| GROUP  | MODEL  |
| ELE    | 2020MY<br>Telluride (ON) LX/S/EX<br>w/Halogen Headlamp |
| NUMBER | DATE   |
| 296    | May 2023   |

## TECHNICAL SERVICE BULLETIN

SUBJECT:

### HALOGEN HEADLAMP REPLACEMENT

This bulletin provides information associated with the 'Halogen Headlamp High Beam Warranty Extension Program' (WTY030) to replace the affected (left and/or right side) headlamp assembly on certain 2020MY Telluride (ON) LX/S/EX vehicles, produced at Kia Georgia from January 09, 2019 through November 18, 2019, which may exhibit a loss of high-beam functionality. Due to an internal failure in the headlamp, the high-beam lights may not illuminate when turning the light switch from the low to high beams. The low-beam function is not affected. The vehicle's warranty for this issue will be extended from 5 years/60,000 miles to 15 years/150,000 miles, whichever comes first, starting from the date the vehicle was first put into service. Follow the procedure outlined in this publication to replace the (left and/or right side) halogen headlamp assembly with a new part.




Halogen Headlamp Assembly

**Replacement Procedure:**

1. Replace the affected (left and/or right side) 'halogen' headlamp assembly by referring to "Body Electrical System → Lighting System → Headlamp → Repair procedures" in the applicable Shop Manual on KGIS.

1. Low/High Beam
2. Daytime Running Light
3. Turn Signal Lamp
8. Side Marker

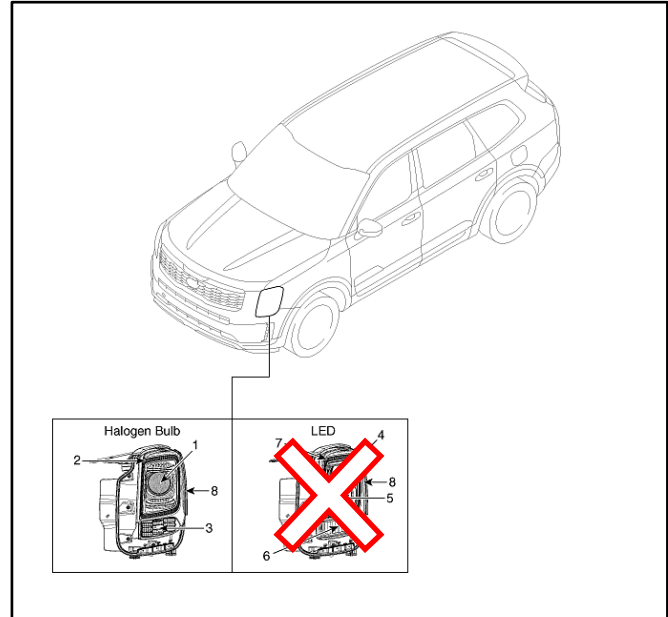

2. Perform Head Lamp Aiming (Adjustment) "Body Electrical System → Lighting System → Headlamp → Repair procedures" in the applicable Shop Manual on KGIS.
3. Confirm normal headlamp lighting function and low-beam/high-beam operation.

SUBJECT:

SUBJECT

## AFFECTED VEHICLE RANGE:

| Model          | Production Date Range                |
|----------------|--------------------------------------|
| Telluride (ON) | January 9, 2019 to November 18, 2019 |

## REQUIRED PART:

| Part Name                         | Part Number | Figure | Qty. |
|-----------------------------------|-------------|--------|------|
| Headlamp Assembly<br>(Left Side)  | 92101 S9000 | N/A    | 1    |
| Headlamp Assembly<br>(Right Side) | 92102 S9000 | N/A    | 1    |

## WARRANTY INFORMATION:

N Code: I11 C Code: ZZ3

| Claim Type | Causal P/N  | Qty. | Repair Description                                       | Labor Op Code | Op Time    | Replacement P/N | Qty. |
|------------|-------------|------|--|---------------|------------|-----------------|------|
| W          | 92101 S9000 | 0    | High-Beam INOP<br>Diagnosis Only                         | 232A07I0      | 0.2<br>M/H | N/A             | 0    |
|            | 92101 S9000 | 1    | Halogen Headlamp<br>Replacement & Aiming<br>(Left Side)  | 232A07R0      | 0.9<br>M/H | N/A             | 0    |
|            | 92102 S9000 | 1    | Halogen Headlamp<br>Replacement & Aiming<br>(Right Side) | 232A07R1      | 0.9<br>M/H | N/A             | 0    |
|            | 92101 S9000 | 1    | Halogen Headlamp<br>Replacement & Aiming<br>(Both Sides) | 232A07R2      | 1.2<br>M/H | 92102 S9000     | 1    |

