

MAS003405 RU 23-13

RAPID UPDATE


FROM: Maserati TSO

TO: Maserati Network



MASTERS OF CARE

Rapid Update 578 Grecale – Door Button Loose

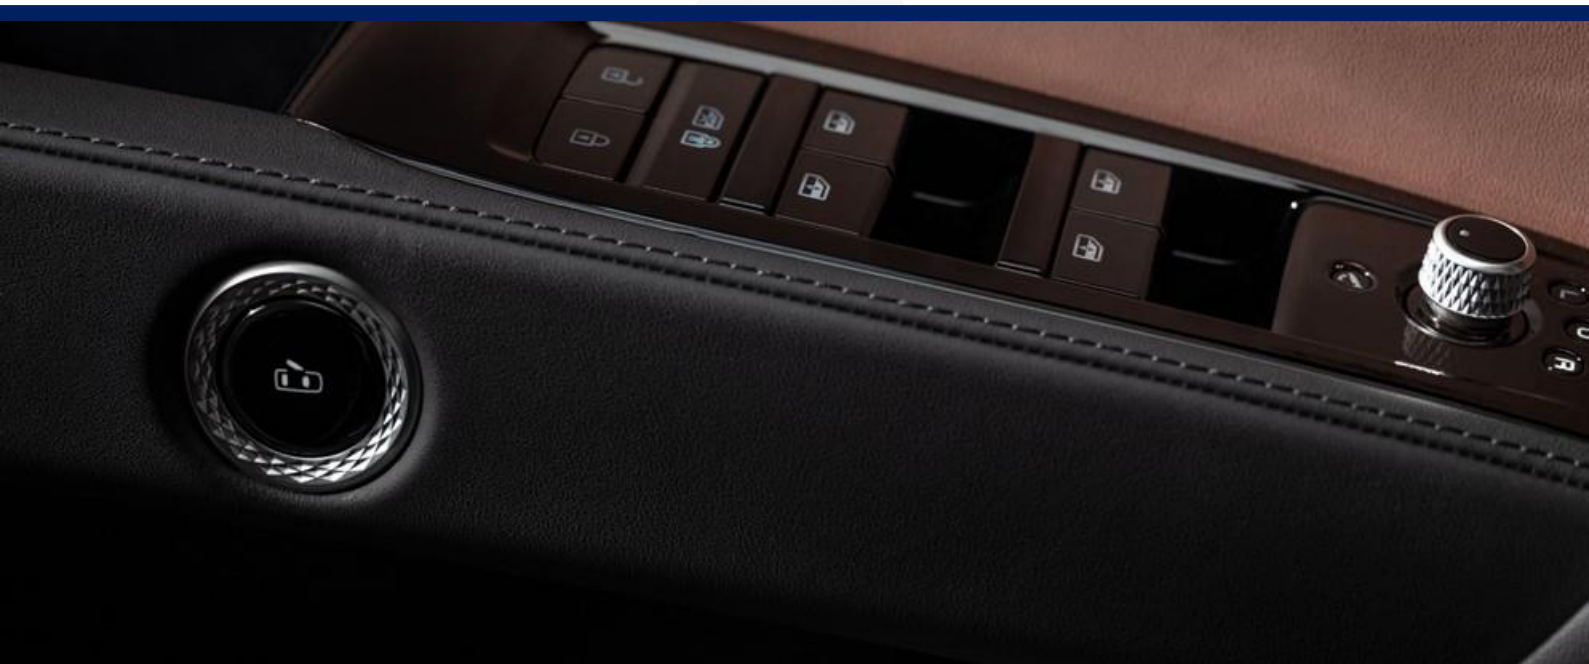

DATE: APRIL 18 2023

Certain Maserati Grecale (M182) MY23 listed in MODISCS+ are involved in a Rapid Update to check that the four-door opening buttons are correctly fitted.

In very few cases, due to a deformation of the hooking teeth, the hooking trim can slip when the button is pressed.

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before starting the procedure.
Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions. (Maseratitechsupport@maserati.com)

Thank You for your continued support and cooperation.

Maserati Americas
Aftersales Dept.

Technical Procedure




All images shown in this bulletin are for illustrative purposes only.

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. Check the functionality of the interior door open buttons for all 4 doors by performing 5 opening/closing cycles for each door.



- **OK** -> buttons remain secure to the ring plates and the door opening command works well for each cycle. Procedure complete. No other actions required.

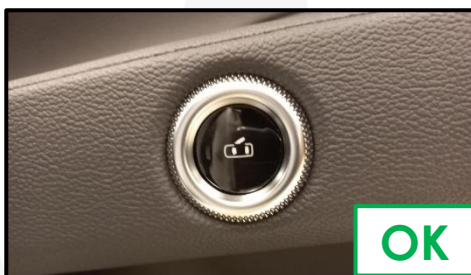

- **NOT OK** -> Push button detached partially from the ring plate and gets stuck, or it detaches totally and falls into the door panel ► Replace the faulty component following the appropriate procedure, indicated below:



- a. 08.52.071 - RH SWITCH FRONT DOOR LOCK - Removal/refitting or replacement
- b. 08.52.072 - LH SWITCH FRONT DOOR LOCK - Removal/refitting or replacement
- c. 08.52.073 - RH SWITCH REAR DOOR LOCK - Removal/refitting or replacement
- d. 08.52.074 - LH SWITCH REAR DOOR LOCK - Removal/refitting or replacement

3. Procedure complete.

Spare Parts

Replace ONLY the part that did not pass the inspection (**NOT OK**):

Spare parts	PN
LH SWITCH DOOR LOCK	670268908
RH SWITCH DOOR LOCK	670268907

Warranty Claim

Fill in the relative Warranty Claims as follows:

Description	Code
Number	578
Warranty Code	23
Fault Code	063
Component Code	8.52.072
Operation Code	
Check (4 buttons)	8.52.072.A (0,20 h)
Component Related Operation Code *	
RH Front Button Replacement	8.52.071.0 (0,55 h)
LH Front Button Replacement	8.52.072.0 (0,55 h)
RH Rear Button Replacement	8.52.073.0 (0,55 h)
LH Rear Button Replacement	8.52.074.0 (0,55 h)

* In case of a faulty component, in addition to the Check Operation Code, please claim only the procedure related to the replaced button.