

MAS003505 RU 23-04

RAPID UPDATE

FROM: Maserati TSO

TO: Maserati Network



Maserati

PERSONAL SERVICE LAB

MASTERS OF CARE

Rapid Update 608 MC20 – Rear Under Tank Frame Washers

TECHNICAL SERVICE OPERATIONS



DATE: APRIL 4 2023

Certain Maserati MC20 (M240) MY22 listed in MODISCS+ are involved in a Rapid Update concerning a rework to install washers to the "Under Tank Frame" screws.

To improve the acoustic comfort of the vehicle, washers were added to the "Under Tank Frame" screws during assembly. The introduction of this component brings considerable benefits in the reduction of vibrations and noise coming from the sub-frame. The rework procedure will require restoring 4 missing washers.

We remind you that all Rapid Updates must be performed at the first entry of the vehicle into the workshop, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for cars in Stock Dealer / PDI, it is necessary to perform all the Update operations before delivery to the end customer, as prescribed by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before starting the procedure.
Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions. (Maseratitechsupport@maserati.com)

Thank You for your continued support and cooperation.

Maserati Americas
Aftersales Dept.

Technical Procedure



All images shown in this bulletin are for illustrative purposes only

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. Safely lift the vehicle on a lift and remove the "REAR AERODYNAMIC CENTRAL COVER".
Refer to workshop procedure: **09.14.090 00 REAR AERODYNAMIC CENTRAL COVER**
3. Identify the 4 (four) screws indicated in **Figure 1**.

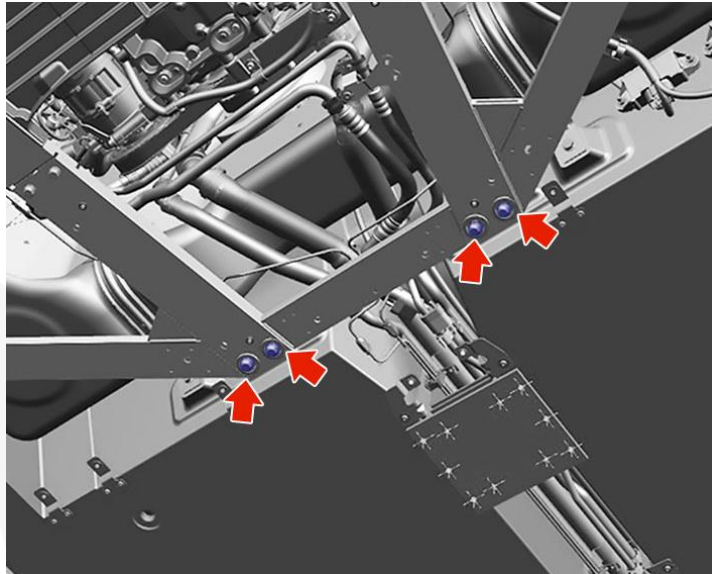


Figure 1

4. Remove one screw at a time from the frame and insert one washer for each screw (one washer per screw) (**Figure 2**). Reinstall the screw and torque it to **50Nm** (36.9 ft-lb).

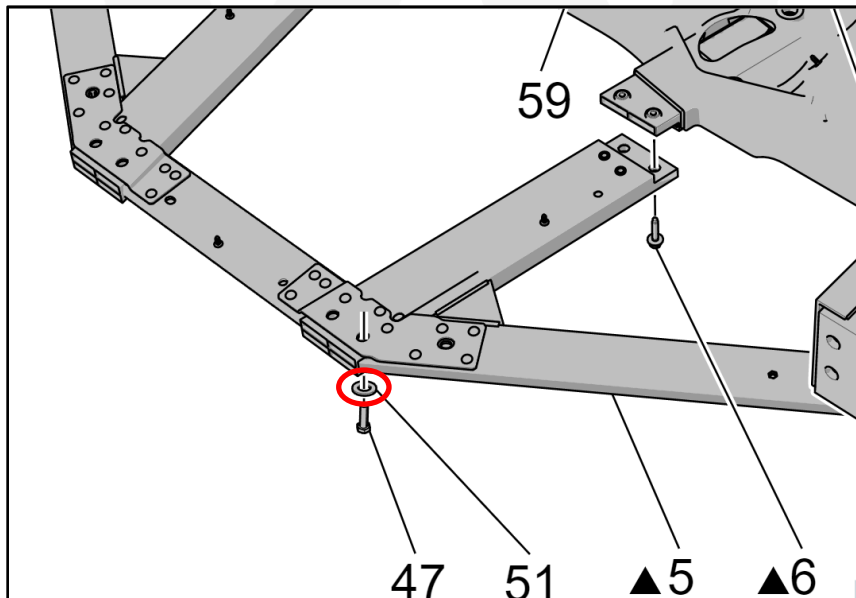


Figure 2

5. Repeat the same procedure for the 3 remaining screws indicated in **Figure 1**.
6. Restore any removed components by following the reverse procedure.
7. procedure complete.

Spare parts

To proceed with the rework, order the following spare parts:

Spare parts	Part number	QTY
Flat washer	675001347	4

Warranty Claim

Fill in the relative Warranty Claims as follows:

Description	Code
Campaign Number	608
Warranty Code	23
Fault Code	063
Component Code	09.09.006
Operation Code	09.09.006.A (0,50 h)