

2021 Ontour

If black plastic is coming out of the AC vent, that typically means the fan blade has shifted and is contacting the plastic housing. To repair, access the roof and remove the cover, there should be 4 shoulder type screws securing it at the base. Then look at the motor and on each side is a bolt securing it in place. There is also a set screw on the fan shaft that needs to be tightened down. if any threads are sticking up on the set screw, that typically means it is loose.

