



Service Bulletin

Bulletin No.: 23-NA-090

Date: May, 2023

TECHNICAL

Subject: Water Intrusion at Front Door Harness Connector X500 and/or X600

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Enclave	2021	2023				
Chevrolet	Traverse						

Involved Region or Country	North America
Additional Options (RPOs)	
Condition	Some customers may comment on a Check Engine Lamp illuminated in the DIC. Technicians may find one or more of the following DTCs set current or in recent history: <ul style="list-style-type: none">• B3125 – Driver Door Only Unlock Circuit• B3130 – All Doors Unlock Circuit• B3135 – All Doors Lock Circuit
Cause	The cause of the condition may be the following suspected points of entry for water intrusion:



6054534

- A-Pillar body plugs are missing



6054536

- Windshield urethane is off it's location

	 <p style="text-align: right;">6054545</p> <ul style="list-style-type: none"> • Door harness grommet are not fully seated
<p>Correction</p>	<p>DO NOT repair the connector or replace the harness without addressing the water source. Once the source of the water intrusion is corrected, then repair connector as required. Refer to SI for proper wire repair procedure.</p>

Service Procedure

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Version	1
Modified	Released May 12, 2023

