

Service Update

N222385700 Main Body Wiring Harness (MBWH) Making Contact With Mounting Stud



Release Date: May 2023

Revision: 00

Attention: This service update includes vehicles in dealer inventory and customer vehicles that return to the dealership for any reason. This bulletin will expire at the end of the involved vehicle's New Vehicle Limited Warranty period.

This field action must only be completed by Cadillac dealers who have met EV Readiness Requirements, and the repair must be performed by a technician who has successfully completed the required training.

For Canadian Dealers: Only Cadillac Dealers who have signed the Cadillac Retail and Facility Standards Addendum and have met all the Cadillac LYRIQ-specific training, tools, and equipment requirements are eligible to complete the repair. Any Dealer unsure of their eligibility status should immediately review with their District Service Manager.

Make	Model	Model Year		RPO	Description
		From	To		
Cadillac	LYRIQ	2023	2023		

Involved vehicles are marked "Open" on the Investigate Vehicle History screen in GM Global Warranty Management system. This site should always be checked to confirm vehicle involvement prior to beginning any required inspections and/or repairs.

Condition	Certain 2023 model year Cadillac LYRIQ vehicles may have a condition where the main body wiring harness (MBWH) could be abraded by a mounting stud.
Correction	Dealers will install a clip to the MBWH to prevent damage from the mounting stud.

Parts

Quantity	Part Name	Part No.
1	Body Harness Stud Clip	13596799

It is estimated that only 192 involved vehicles will require parts replaced. **Due to the small number of vehicles anticipated that will need this fix and the limited initial parts availability, dealers are encouraged not to order these parts for use as shelf stock.**

Reminder: Parts may be removed from Retail Inventory Management (RIM). Dealers should review the affected parts to confirm RIM managed status. Parts may have quantity limiters in effect.

Warranty Information

Labor Operation	Description	Labor Time	Trans. Type	Net Item
9106582	Install Clip On Stud Near Rear Body Harness	0.9	ZFAT	N/A

Service Procedure

1. Remove the Quarter Lower Rear Trim Panel. Refer to *Quarter Lower Rear Trim Panel Replacement - Left Side* in SI.

Service Update

N222385700 Main Body Wiring Harness (MBWH) Making Contact With Mounting Stud



6224053

2. Locate the stud near the module shown under the Quarter Lower Rear Trim Panel. Clip the entirety of the zip tie off the body harness stud clip, then install the clip over the stud to protect the wiring harness.
3. Reinstall the Quarter Lower Rear Trim Panel. Refer to *Quarter Lower Rear Trim Panel Replacement - Left Side* in SI.

Dealer Responsibility

Whenever a vehicle subject to this service update enters your vehicle inventory or is in your facility for service in the future, and the vehicle is still covered under the New Vehicle Limited Warranty, you must take the steps necessary to be sure the service update correction has been made before selling or releasing the vehicle.

All new, used, GM Certified Used, courtesy transportation vehicles, dealer shuttle vehicles, etc. in dealers' possession and subject to this bulletin must be held and inspected/repared per the service procedure of this bulletin before customers take possession of these vehicles. Involved vehicles must be held and not delivered to customers, dealer-traded, released to auction, used for demonstration, or any other purpose.

All GM Certified Used vehicles currently in the dealers' inventory within the Certified Pre-Owned Inventory System (CPOIS) will be de-certified and must be held and remedied per the service procedure in this bulletin. Upon submitting an accepted/paid warranty transaction in the Global Warranty Management (GWM) system, the vehicle can be re-certified for sale within the CPOIS system, or once again be used in the CTP program.

Dealer Reports – For USA & Export

The Inventory tab of the Open Vehicle Report will contain Service Update Bulletin VINs that apply to this field action. This information is intended to assist dealers with the **PROMPT COMPLETION** of these vehicles. The Customer In-Service tab will not contain Service Update Bulletin VIN data because the intent of a Service Update Bulletin is to not inconvenience a customer with a special trip for service. Service Update Bulletins are to be completed when the customer is in for a regularly scheduled visit.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the tools, equipment, safety instructions, and know-how to do a job properly and safely. If a condition is described, **DO NOT** assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your dealer for information on whether your vehicle may benefit from the information.



**We Support
Voluntary Technician
Certification**

GLOBAL SAFETY FIELD INVESTIGATIONS
DCS6576
URGENT - DISTRIBUTE IMMEDIATELY

Date: May 22, 2023

Subject: N222385700 - Service Update
Main Body Wiring Harness (MBWH) Making Contact With Mounting
Stud

Models: 2023 Cadillac LYRIQ

To: All General Motors Dealers

General Motors is releasing Service Update N222385700 today. The total number of U.S. vehicles involved is 184. Please see the attached bulletin for details.

Global Warranty Management (GWM)

The Required Field Action section on the Investigate Vehicle History (IVH) screen will be updated May 22, 2023. A list of vehicles in dealer inventory is attached to this message. Please hold all warranty transactions until IVH has been updated.

END OF MESSAGE

GLOBAL SAFETY FIELD INVESTIGATIONS