

| | | | | | |
|---------------------------|--|--------------|----------------|--|-----------|
| REFERENCE: | TSB: 18-052-23 GROUP 18 - Vehicle Performance | Date: | April 21, 2023 | REVISION: | 18-155-22 |
| VEHICLES AFFECTED: | 2023 (JL) Jeep Wrangler This bulletin applies to vehicles built on or before October 26, 2022 (MDH 1026XX) equipped with the 3.0L V6 Turbo Diesel Engine W/ESS (Sales Code EXJ) . | | | MARKET APPLICABILITY: <input checked="" type="checkbox"/> NA <input type="checkbox"/> CH <input checked="" type="checkbox"/> **EE** <input type="checkbox"/> IAP <input checked="" type="checkbox"/> **SA** <input type="checkbox"/> MEA | |
| CUSTOMER SYMPTOM: | <p>Customers may experience a Malfunction Indicator Lamp (MIL) illumination. Upon further investigation, a technician may find one or more of the following Diagnostic Trouble Codes (DTCs) have been set:</p> <ul style="list-style-type: none"> • P016F - Closed Loop Fuel Pressure Control At Limit - Pressure Too Low. • P025C - Fuel Pump Module Control Circuit Low. • P0300-00 - Multiple Cylinder Misfire. • P0301-00 - Cylinder 1 Misfire. • P0302-00 - Cylinder 2 Misfire. • P0303-00 - Cylinder 3 Misfire. • P0304-00 - Cylinder 4 Misfire. • P0305-00 - Cylinder 5 Misfire. • P0403-00 - EGR Control Circuit Open (Disabled Fault). • P208B - Reductant Pump 1 Control Performance. <p>Other Software enhancements:</p> <ul style="list-style-type: none"> • Low speed engine idle improvements. • Improved engine restart performance and torque response during low fuel level and/or hot ambient conditions. | | | | |
| CAUSE: | PCM software | | | | |

This bulletin supersedes Technical Service Bulletin (TSB) 18-155-22, date of issue November 29, 2022, which should be removed from your files. All revisions are highlighted with ****asterisks**** and include additional markets, converting to an RSU, steps and LOP.

****This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 23-115, date of issue April 21, 2023. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty. This RSU will expire 18 months after the date of issue.****

REPAIR SUMMARY:

This bulletin involves reprogramming the PCM with the latest available software.

CLAIMS DATA:

| Labor Operation No: | Labor Description | Skill Category | Labor Time |
|---------------------|---|-----------------------------------|------------|
| **18-19-04-TJ | Module, Powertrain Control (PCM) - Inspect (0 - Introduction) | 1 - Engine Repair and Performance | 0.2 Hrs.** |
| 18-19-04-TE | Module, Powertrain Control (PCM) - Inspect and Reprogram (0 - Introduction) | 1 - Engine Repair and Performance | 0.3 Hrs. |

| Labor Operation No: | Labor Description | Skill Category | Labor Time |
|---------------------|-------------------|------------------|------------|
| Failure code | RF | Required Flash | |
| | CC | Customer Concern | |

The dealer must choose which failure code to use depending on if this is a Rapid Service Update (RSU) or Technical Service Bulletin.

- The “RF” failure code is required for essential module flash/reprogramming and can only be used after confirmation that the VIN is included on the RSU.
- The failure code “RF” (Required Flash) can no longer be used on Technical Service Bulletin flashes. The “RF” failure code must be used on an RSU.
- If the customer’s concern matches the SYMPTOM/CONDITION identified in the Technical Service Bulletin, failure code CC is to be used. When utilizing this failure code, the 3C’s must be supplied.

DIAGNOSIS:

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in DealerCONNECT/ Service Library, verify all related systems are functioning as designed. If DTCs or symptom conditions, other than the ones listed above are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

****If a customer’s VIN is listed in VIP or your RSU VIN list, perform the repair. If any vehicle not on the VIN list exhibits any of the symptoms listed above in the customer symptom section, perform the Repair Procedure.****

SPECIAL TOOLS/EQUIPMENT:

| Description | Ref. No. | Notes |
|----------------------|----------|-------|
| wiTECH or Equivalent | – | – |

REPAIR PROCEDURE:

NOTE: Install a battery charger to ensure battery voltage does not drop below 13.2 volts. Do not allow the charging voltage to climb above 13.5 volts during the flash process.

NOTE: If this flash process is interrupted/aborted, the flash should be restarted.

1. ****Is the vehicle on the RSU VIN list?**
 - YES>>> Proceed to [Step 2](#).
 - NO>>> Proceed to [Step 3](#).
2. Does the PCM have the latest software already installed?
 - YES>>> This bulletin has been completed, use inspect LOP (18-19-04-TJ) to close the active RSU.
 - NO>>> Proceed to [Step 3](#).******
3. Reprogram the PCM with the latest software. Detailed instructions for flashing control modules using the wiTECH Diagnostic Application are available by selecting the application’s “HELP” tab.
4. Clear any DTCs that may have been set in any module due to reprogramming. The wiTECH application will automatically present all DTCs after the flash and allows them to be cleared.

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.