

**Noise Symptom - Humming from Vehicle Front End: Observe Specified Procedure (SY 117/22)**

Model Line: **Taycan (Y1A / Y1B / Y1C)**

Model Year: **As of 2020 up to 2022**

Concerns: **Electric fan**

Symptom: Customers complain about droning or humming noise from the front end, even during the charging process.

Cause: This may be caused by foreign matter or dirt in the area of the electric fan and/or between the fan rotor and fan frame.  
Frequent driving on unpaved roads or roads with a gravel or grit surface or on sanded roads (winter) exacerbates the problem.

Remedial Action: A new component status of the electric fan (fan with frame and fan motor cap) as well as the air guides and lower parts of the wheel housing liners is available immediately.  
  
The new design has additional and larger foreign matter elimination openings on the underside as well as a protective cap to prevent dirt and stones from entering the fan motor.

**Required parts**

Parts Info: **Required parts:**

<b>Part No.</b>	<b>Designation - Point of use</b>	<b>Quantity</b>
PAD121203A	⇒ Radiator fan including bracket - left	1 piece
PAD121205A	⇒ Radiator fan including bracket - right	1 piece
9J1121673	⇒ Air guide - left	1 piece
9J1121674	⇒ Air guide - right	1 piece

9J1122355A	⇒ Frame – left	1 piece
9J1122356A	⇒ Frame – right	1 piece
PAD809957A	⇒ Wheel housing liner lower part – bottom left  M-no. K8D	1 piece
PAD809958A	⇒ Wheel housing liner lower part – bottom right  M-no. K8D	1 piece
<b>or</b>		
PAD809957B	⇒ Wheel housing liner lower part – bottom left  M-no. K8S	1 piece
PAD809958B	⇒ Wheel housing liner lower part – bottom right  M-no. K8S	1 piece

### Required tools

Tool: • **VAS 6959 - Torx screwdriver insert T30**

### Replacing electric fan

Work Replace electric fan, air guide and lower right and left wheel housing liner parts (front, part).  
Procedure: For instructions, see: ⇒ *Workshop Manual '190819 Removing and installing electric fan'* (includes removing and installing air guide and wheel housing liner)

### Invoicing

Use the labor operation specified below for invoicing the work involved.

APOS	Labor operation	I No.
19241951	Removing and installing front air guides	
19241952	Removing and installing front air guides	
19081950	Removing and installing electric fan	

References: ⇒ *Workshop Manual '190819 Removing and installing electric fan'*

**Important Notice:** Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2023 Porsche Cars North America, Inc.