

POWERTRAIN – P6 ENGINE, INCLUDING PHEV – ROUGH IDLE, MIL ON

Customer Voice:

- Customer may report rough engine idle, transmission not shifting correctly under load, or a MIL.

Technical Description:

- MIL with DTC P2177-00 for lean bank 1.
- Some vehicles have been found to have damaged/torn air intake hose on the left side.

Status:

- Check left side air duct for any damage. Part number, LR157563.
- If there is a tear as shown in the attachment, please replace the intake hose and submit an EPQR referencing the SSM.

Refer to SSM 75993

22-23MY Range Rover, RR Sport

