

Reference	SSM75993
Models	New Range Rover / L460 New Range Rover Sport / L461
Title	L460/ L461 - P6 Engine including PHEV - rough idle, MIL on
Category	Driveability
Last modified	03-May-2023 00:00:00
Symptom	608000 Runs Rough
Attachments	air duct 1.jpg (air duct 1.jpg)
Content	<p><u>Issue:</u> Customer may report rough engine idle, transmission not shifting correctly under load, or a MIL with DTC P2177-00 for lean bank 1.</p> <p><u>Cause:</u> Some vehicles have been found to have damaged air intake hose on the left side.</p> <p><u>Action:</u> Check left side air duct for any damage. Part number, LR157563. If there is a tear as shown in the attachment, please replace the intake hose and submit an EPQR referencing this SSM.</p>

anBhdHRicnM7MjAyMyDwNS0wNVQxMjowNDoxMy44OTIhOzEzNi4yMyYyNzIuMTA1Ow==