

Technical product information

Topic	New Continental GT & GTC - Adjustable rear spoiler fails to operate - DTC B18AC19 is evident within 006B
Market area	Bentley: worldwide (2WBE)
Brand	Bentley
Transaction No.	2051524/4
Level	EH
Status	Approval
Release date	

Event memory entries

Diagnostic address	Event memory entry	Fault type	Fault status
006B - Aerodynamic control module	B18AC19: Motor for rear spoiler drive 1 Current too high		Intermittent
006B - Aerodynamic control module	B18AC19: Motor for rear spoiler drive 1 Current too high		static

New customer code

Object of complaint	Complaint type	Position
body fixtures and fittings -> spoilers, air intake grilles, brackets	functionality	
vehicle service -> vehicle diagnosis	control units, services	

Vehicle data

New Continental GT/C

Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
3S3*	2018	E		*	*	*
3S3*	2019	E		*	*	*
3S3*	2020	E		*	*	*
3S3*	2021	E		*	*	*
3S3*	2022	E		*	*	*
3S3*	2023	E		*	*	*
3S4*	2019	E		*	*	*
3S4*	2020	E		*	*	*
3S4*	2021	E		*	*	*
3S4*	2022	E		*	*	*
3S4*	2023	E		*	*	*

Documents

Document name
master.xml

New Continental GT - Adjustable rear spoiler fails to operate - DTC B18AC19 is evident within 006B

Customer statement / workshop findings

Adjustable rear spoiler fails to operate

Technical background

Diagnostic Trouble Code (DTC) logged in the Aerodynamics Control Unit (Address 6B) - The DTC is *B18AC19 Motor for rear spoiler drive 1 Current High*

Production change

All VIN's post SCBCA13S5JC069119 have a later specification Adjustable rear spoiler control unit (J223) fitted and should not be affected by this issue, however in the event that this issue is evident please raise a DISS query and await feedback before conducting any further work.

Measure

1) Replace the Adjustable rear spoiler control unit J223 - Refer to Rep.Gr 66

NOTICE

Road test is not required please conduct a static test of the rear spoiler to confirm the rear spoiler is operational, road test warranty claims will be cancelled

Warranty accounting instructions

Time to replace the deployable rear spoiler assembly (lifting platform)

Warranty Type 110 or 910

Damage Service Number 66 58

Damage Code 0040

Labour

Labour operation code 66 58 19 00

Time 70 Time units

Diagnosis time

Labour operation code 01 50 00 00

Time As per ODIS log (Must not exceed 20 Time units)

NOTICE

Road test is not required please conduct a static test of the rear spoiler to confirm the rear spoiler is operational, road test warranty claims will be cancelled