



Bulletin No.: PIT6010
Published date: 05/4/2023

Preliminary Information

PIT6010 U135A After Replacement of Trans Range Control Module

Product Investigation Review Required

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	Lacrosse	2017 - 2019	All	All	All	All
Cadillac	XT5	2017 - 2019	All	All	All	All

Involved Region or Country	North America
Condition	After installing a K173 Transmission Range Control Module (TRCM) a SES light, or Service Transmission Soon message may appear. Upon checking codes U135A and possibly P26C8 will be found.
Cause	Compatibility between new K173 TRCM and software

Correction:

If the code U135A or P26C8 were set before replacing the TRCM follow normal diagnostics found in SI.
If the code(s) were not set until after the TRCM was replaced do not perform any additional repairs to the vehicle.
Engineering is working on a solution to this concern and a bulletin will be issued when a repair is made available.

Note: After 50 ignition cycles the vehicle will no longer shift from park until the code is cleared with a scan tool.

Version History

Version	1
Modified	05/03/2023 - Created on.



GENERAL MOTORS

© 2023 General Motors. All Rights Reserved.