

Preliminary Information

PIT6025 Brake System Automated Bleed Fails

Models

Brand:	Model:	Model Years:	VIN:		Engine	Transmissions:
			from	to	Engine:	Transmissions.
Chevrolet	Colorado	2023	All	All	All	All
GMC	Canyon	2023	All	All	All	All

Involved Region or Country:	North America
Condition:	GDS Automated Bleed procedure fails.
Cause:	BSCM software concern.

Correction:

Update the brake module software before re attempting the bleed. If there is still an issue, when the scan tool advises to disconnect the fluid level sensor, ground pin 1, circuit 333 at the fluid level sensor connector before selecting "Continue" on the tool.

Version History

Version	1
Modified	05/23/2023 - Created on.



© 2023 General Motors. All Rights Reserved.