



SIB 65 13 23

2023-05-05

## CENTRAL INFORMATION DISPLAY TURNS BLACK

This Service Information Bulletin (Revision 1) replaces SI B65 13 23 dated February 2023.

**What's New:**

- Defect Code and Claim Information statements updated

<input checked="" type="checkbox"/>	THIS REPAIR IS MOBILE FRIENDLY
-------------------------------------	--------------------------------

**MODEL**

E-Series	Model Description	Production Date
G70	7 Series Sedan	From July 2022

**SITUATION**

Intermittently the Central Information Display (CID) portion of the Multifunctional Display will display only black.

**CAUSE**

Unfavorable software in the head unit (HU-H5).

**CORRECTION**

Program the head unit (HU-H5).

**PROCEDURE**

Determine the vehicle's current integration level either by using AIR or ISPA NEXT/AWP (Aftersales Workplace) applications.

Is the current I-level lower than G070-23-03-510?

**Yes** – Proceed to the next step and update the vehicle software

**No** – Continue with standard troubleshooting

Program the vehicle to I-level G070-23-03-510 or higher using **ISTA 4.40.1** or higher (released late Feb. 2023).

- Connect a BMW-approved battery charger to the vehicle
- Connect the programming system to the vehicle (ISTA 4)
- Determine measures plan
- Accept and fully work through the measures plan with the control units to be programmed/encoded and enabled
- Follow the rework list
- Depending on the rework list, carry out a vehicle test and delete the fault memory if needed**

After the programming has been fully completed, check functionality of the system.

Note: ISTA will automatically reprogram and code all programmable control modules that do not have the latest software.

**Always connect a BMW-approved battery charger/power supply (SIB 04 23 10).**

For information on programming and coding with ISTA, refer to Dealer Universal Portal / TIS / Technical Documentation / Diagnostics and Programming / Programming Documentation.

**CLAIM INFORMATION**

Vehicle Programming and Encoding

During this workshop visit, the affected vehicle may show one or more programming and encoding Technical Campaign repairs open. The programming and encoding procedure may only be invoiced one time.

**Select one of these open Technical Campaigns to perform and submit for updating the vehicle's software to the required I-level or higher.**

**Please be sure to perform any additional before and/or after work (including attaching labels) as required by the open campaigns on the vehicle. Close any remaining open programming and encoding Campaign repairs as outlined in the corresponding Service Information Bulletin.**

Only if the above situation does not apply, the BMW software solution is then:

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks or the BMW Certified Pre-Owned Program.

<b>Defect Code:</b>	<b>6512580200</b>	<b>Head Unit High HU-H (Nav Professional) Software error / internal device fault</b>
---------------------	-------------------	--

Refer to AIR for the corresponding flat rate unit (FRU) allowances.

<b>Labor Operation</b>	<b>Description</b>	<b>Labor Allowance</b>
00 00 006	Carrying out vehicle test (Main work)	Refer to AIR
Or:		
00 00 556	Carrying out vehicle test (Plus work)	Refer to AIR
And:		
61 21 528	Supporting voltage of the vehicle electrical system / recharging vehicle battery	Refer to AIR
And, as needed:		
61 00 006*	Carrying out vehicle diagnosis, ABL (Work time)	WT
Or:		
00 58 500*	Diagnosis Worktime Flat Rate	2 FRU
And		
61 00 730	Program/encode control unit(s), includes deleting the fault memory	Refer to AIR

If you are using a Main labor code for another repair, use the Plus code labor operation 00 00 556 instead of 00 00 006, or exclude (including 61 21 528) when the Vehicle Test is included in another repair.

Work time labor operation codes 61 00 006 and 00 58 500 are not considered Main labor operations.

#### **Vehicle Programming and Encoding – Additional Work (RO and Claim Comments Required)**

This procedure automatically reprograms and encodes any vehicle control modules that do not have the latest software I-level.

If one or more control modules fail during the reprogramming procedure, claim the required consequential repair work procedures to address this issue (including performing the IRAP Control Unit Recovery first as required, refer to the SIB in AIR) under the Defect Code in this bulletin with the labor operations in AIR that apply.

Please explain the additional work procedures that were performed (The why and the what) on the repair order and in the claim comments.

For covered repairs that address control module failures that occurred prior to performing this reprogramming procedure, claim this work with the Defect Code and labor operations (including the diagnosis that applies\*) in AIR that apply.

\*Based on which one applies to your center, please refer to **SI B01 01 20** or **B01 07 20** for the applicable procedure for documenting, claiming, and explaining, on the RO and in the claim comments, your diagnosis work time (WT), job/repair work time (WT), and the vehicle repairs your center performed, unless otherwise required by State law.

Other Repairs

If other eligible and covered work is performed because of performing the ISTA diagnostics and related test plans, claim this work with the applicable defect code and the labor operations listed in AIR (including diagnosis that applies\*).

FEEDBACK REGARDING THIS BULLETIN

Technical Feedback	To submit feedback for the technical topic of this bulletin: Submit your feedback in the rating box at the top of this bulletin
Warranty Feedback	To submit feedback for the CLAIMS section of this bulletin: Submit an IDS ticket to the Warranty Department, or use the chat available in the Warranty Documentation Portal
Parts Feedback	To submit feedback for the PARTS section of this bulletin: Submit an IDS ticket to the Parts Department

