| | GROUP | MODEL | | |
|---|--------------------------|--|--|--|
| (KIN) | Electrical | 2017-18MY Forte (YDm) Soul (PS) Sportage (QL) | | |
| | NUMBER | DATE | | |
| | PS610 (Rev 1 06/26/2023) | June 2019 | | |
| PITSTOP TECHNICAL OPERATIONS | | | | |
| SUBJECT: SRS DTC B176200 AND/OR B168400 | | | | |
| | | | | |

This pitstop has been revised to include additional information. New/revised sections of this pitstop are indicated by a black bar in the margin area.

This Pitstop provides information regarding a possible mismatch of a SRSCM (Supplemental Restraint System Control Module) and driver seat belt buckle that may set the SRS DTC(s) B168400 and/or B176200 on the models listed below. When diagnosing a vehicle that has been in an accident and/or has recently had a superseded SRSCM replaced, it may be necessary to inspect and replace the driver seat belt buckle with the latest production P/N listed in EPC. Older production driver seat belt buckles have a 4 pin connector and may no longer be compatible with the superseded SRSCM. Only the SRSCM is superseded; the driver seat belt buckle is not superseded.

DTC B176200: ACU Coding Error DTC B168400: Not Configured Device is Detected

| Model | MY | SS SRSCM P/N | Updated Driver Seat Belt Buckle P/N |
|-------|---------|--------------|-------------------------------------|
| YDm | | 95910 B0100 | 88830 B0550 <u>XX</u> |
| PS | 2017-18 | 95910 B2600 | 88830 B2550 <u>XX</u> |
| QL | | 95910 D9050 | 88830 D9550 <u>XX</u> |

Note: Add the applicable "XX" color code per VIN to the required/applicable Part Number.