

#### 70 Noises from top of front door trim panel

70 23 83 2066883/2 June 26, 2023. Supersedes Technical Service Bulletin Group 70 number 22-74 dated April 26, 2022, for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment	
A5, A5 Cabriolet, A5 Sportback, S5, S5 Cabriolet, S5 Sportback	2018 – 2024		Not Applicable	
RS 5	2018 – 2019 2021 – 2024	All		
RS 5 Sportback	2019 2021 - 2024			

### Condition

REVISION HISTORY				
Revision	Date	Purpose		
2	-	Revised header (Add Model Year)		
1	04/26/2022	Initial publication		

#### **Customer states:**

• Noises from front door trim panel(s) when resting arm on window sill.

#### **Workshop findings:**

• Customer complaint can be reproduced.

## **Technical Background**

Relative movement between door trim panel and window sill due to unfavorable tolerances.

### **Production Solution**

Not Applicable

### **Service**

#### Page 1 of 4

#### © 2023 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



- 1. Remove the affected door trim panel(s) by following the Elsa Repair Manual.
- 2. Cut a 500 mm (~19.7 inches) long piece of fleece adhesive tape **D 373 125 A2**.
- 3. Apply this piece of fleece tape to the entire length of the inner window slot seal (Figure 1).



Figure 1. Applying fleece tape to inner window slot seal

4. Reinstall the door trim panel according to the Elsa Repair manual. It is important that the door trim panel is positioned/pressed as far down as possible to ensure contact between the door trim panel attachment strip and the window slot seal.



Warning: Do not apply anything to the crash element on the door trim panel or its retaining clamp on the door (Figure 2). This is strictly prohibited!





**Figure 2.** Incorrect application of fleece tape on crash element. Do not attach anything to the crash element or its retaining clamp!

#### Brief note on function of crash element:

Prevents premature detachment of the door trim panel from the door.

- The crash element is locked in the retaining clamp during intrusion and retains the door trim panel to the door.
- · Prevents a gap in which the side airbag could get caught while inflating.

## **Warranty**

Claim Type:	<ul> <li>110 up to 6 Months/6,000 Miles.</li> <li>1AM over 6 Months/6,000 Miles.</li> </ul>				
	If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.				
Service Number:	7059				
Damage Code:	0020				
Labor Operations:	Front door trim panel remove + reinstall	7059 1900	See SRT with associated operations		
	2 Front door trim panels remove + reinstall	7059 2000	See SRT with associated operations		
	Modify 1 front door trim panel	7059 4999	10 TU		
	Or	Or	Or		
	Modify 2 front door trim panel	7059 5099	20 TU		
Diagnostic Time:	GFF	No allowance	0 TU		
	Road test prior to the service procedure	No allowance	0 TU		
	Road test after the service procedure	No allowance	0 TU		
Claim Comment: As per TSB 2066883/2					
All warranty claims submitted for nayment must be in accordance with the Audi Marranty Policies and Procedure					

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



## **Required Parts and Tools**

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.						
Part Number	Part Description	Quantity				
See ETKA	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA				
D 373125A2	Fleece adhesive tape	0.10				

### **Additional Information**

All parts and service references provided in this TSB (2066883) are subject to change and/or removal.

©2023 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.