



GROUP	MODEL
BOD	2023MY Telluride (ON)
NUMBER	DATE
320	June 2023

## TECHNICAL SERVICE BULLETIN

SUBJECT: **FRONT DRIVER DOOR BELT OUTSIDE  
WEATHERSTRIP INSPECTION/REPLACEMENT (SA535)**

This bulletin provides information to inspect front driver door belt outside weatherstrip on some 2023MY Telluride (ON) vehicles produced from March 13, 2023 through June 6, 2023. The affected vehicles may be missing an adhesive layer causing the outer faceplate to detach/separate from the molding. Follow the procedure outlined in this publication to inspect and, if necessary, replace the driver front door belt outside weatherstrip. Before conducting the procedure, verify that the vehicle is included in the list of affected VINs.



### NOTICE

A Service Action is a repair program without customer notification that is performed during the warranty period. Any dealer requesting to perform this repair outside the warranty period will require DPSM approval.

Repair status for a VIN is provided on KDealer+ (Service → Warranty Coverage → Warranty Coverage Inquiry → Campaign Information). Not completed Recall / Service Action reports are available on KDealer+ (Consumer Affairs → Not Completed Recall → Recall VIN → Select Report), which includes a list of affected vehicles.

This issue number is SA535.

SUBJECT:

## DRIVER FRONT DOOR BELT OUTSIDE WEATHERSTRIP INSPECTION/REPLACEMENT (SA535)


### Inspection Procedure:

1. Confirm that the outer faceplate is not detached/separated (coming unglued) from the molding by gently pulling using fingers:

- If the outer faceplate is not detached or separating from the molding (OK), no further action required.




- If the outer faceplate is detached or separating from the molding (NG), proceed to the 'Replacement Procedure' below.

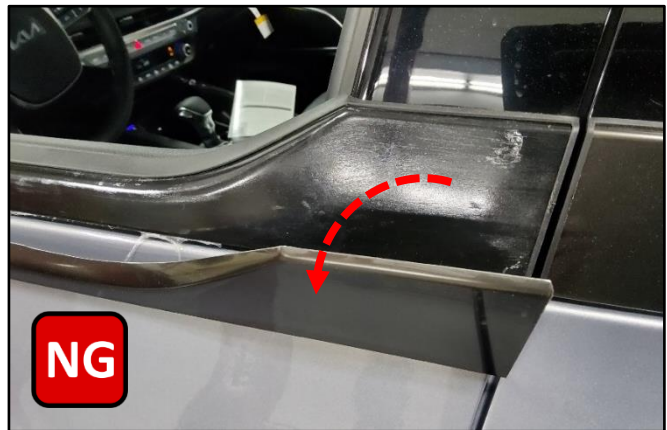

### Replacement Procedure:

1. Remove the front door weatherstrip (A) by referring to "Body (Interior and Exterior) → Front Door → Front Door Weatherstrip → Repair procedures" in the applicable Shop Manual on KGIS.

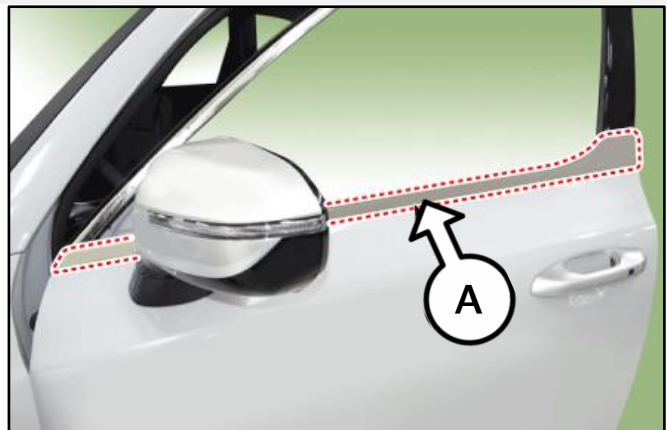

SUBJECT:

## DRIVER FRONT DOOR BELT OUTSIDE WEATHERSTRIP INSPECTION/REPLACEMENT (SA535)

## AFFECTED VEHICLE RANGE:

Model	Production Date Range
Telluride (ON)	March 13, 2023 to June 6, 2023

## REQUIRED PART:

Part Name	Part Number	Figure	Qty.
Driver Front Door Weatherstrip	82210 S9100QQK	N/A	1

## WARRANTY INFORMATION:

N Code: N99 C Code: C99

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
V	82210 S9100	0	(SA535) Front Door Weatherstrip Inspection (OK)	230A1310	0.2 M/H	N/A	0
			(SA535) Front Door Weatherstrip Inspection (NG) and Replacement	230A13R0	0.3 M/H	82210 S9100QQK	1

 **NOTICE**

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference SA535 when accessing the KDealer+ system.

