

Trunk Lid Power Closing Function Inoperative

Topic number	LI80.40-P-075378
Version	3
Function group	80.40 - Power locking
Date	6/7/23
Validity	MODEL 213.0 with code 881 from manufacturing date April 1, 2021. MODEL 213.1 with code 881 from manufacturing date April 1, 2021. MODEL 257 with code 881 from manufacturing date April 1, 2021. MODEL 238 with code 881 from manufacturing date April 1, 2021.
Reason for change	Cause and remedy adjusted

Complaint

The trunk lid is not drawn into the end position with the help of the trunk lid power closing function after the electric closing process.

There is a loud rattling from the trunk or from the trunk lid power closing unit (M14/31).

Cause

Toothed drive wheel in trunk lid power closing unit (M14/31) has run over the limit stop.

Remedy

Replace trunk lid power closing unit (M14/31).

Symptoms
Body > Door/Flap > Hood/flap > Trunk lid/liftgate > Does not close
Body > Door/Flap > Power closing > Malfunction

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A0999067105			Gear motor power closing function	1		X

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note

XENTRY TIPS

		8062536	
--	--	---------	--