

## Vehicle handover cannot be performed

---

Topic number	LI00.20-P-075495
Version	1
Function group	00.20 - Maintenance, service system (FSS, ASSYST)
Date	10/27/22
Validity	Model series 223
Reason for change	

---

### Complaint

1. "Perform vehicle handover" in the workshop menu to start the maintenance computer for service A/B cannot be carried out.
2. Service confirmation is not possible because "Perform vehicle handover" is displayed. This cannot be carried out.

### Cause

Routine change in software in instrument cluster N133/1. Vehicle handover has not taken place.

### Remedy

Manually commission already-installed instrument cluster control unit N133/1 and then perform special procedure to re-initialize ASSYST data in powertrain control unit N127.

Symptoms				
Overall vehicle > Maintenance > Active Service System ASSYST > Cannot be programmed				
Overall vehicle > Maintenance > Active Service System Plus ASSYST PLUS > Implausible				
Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			540R3F1	