



Battery Electric Vehicle (BEV) Model VNR-E Insufficient Cab Cooling



Internal Content

8743-03-02-07 in Impact to replace the non-working

Volvo Trucks has determined that certain VNRe model vehicles may have an issue with the electric air conditioning system that could cause only one of the two electric air conditioning compressors to operate correctly. This is caused by incorrect A/C compressor CAN ID.


This solution applies to vehicles built between March 26, 2021 and April 8, 2022.

Air Conditioning Compressor Inspection/Replacement

Parts Information (If compressor replacement is needed)

Part Number	Description	Quantity
23415508	A/C Compressor	1

If the HVAC system is not sufficiently cooling the cab verify both A/C compressors are p/n 23415508.

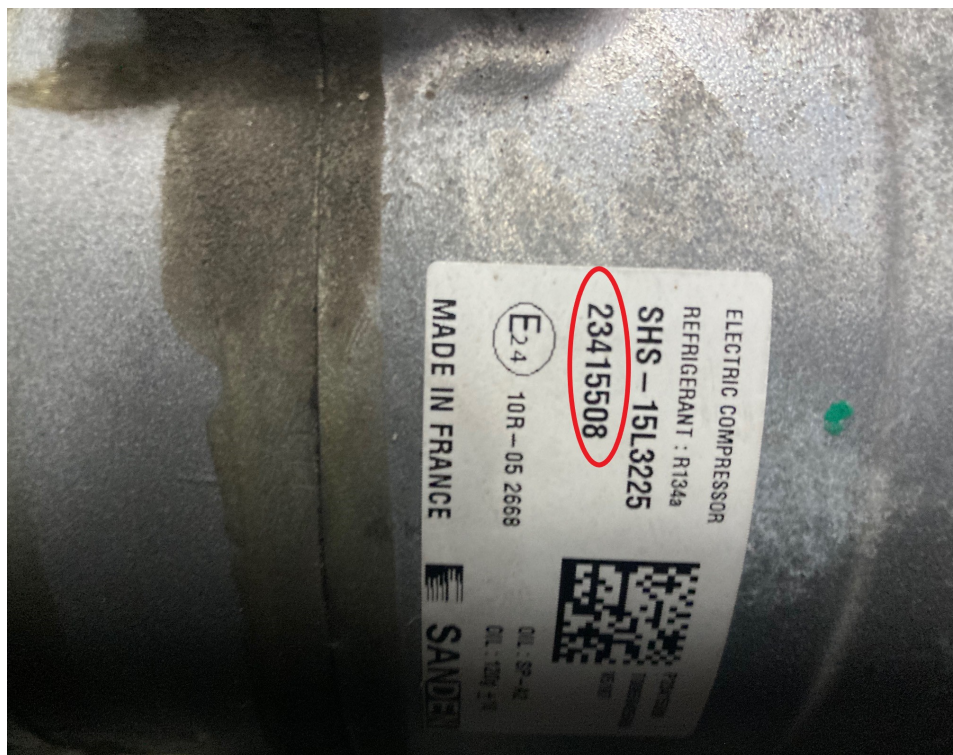

In the event both A/C compressors are not p/n 23415508 please replace the non - 23415508 compressor.

NOTE: Both A/C compressors must be p/n 23415508.

If cab cooling is still insufficient further test must be completed.

Tags [bev](#) [volvo](#) [a/c compressor](#)

Categories *

Make and Model > Volvo > VNR Electric

Vehicle System > HVAC

 [Live UI](#) [Related links and attachments](#)

 [Feedback](#)

No links or attachments available

[Give feedback](#)

to help improve the content of this article