
Reference	SSM76008
Models	New Range Rover / L460 New Range Rover Sport / L461
Title	L460 / L461 Red Suspension Warning Light in Cluster
Category	Chassis
Last modified	02-Jun-2023 00:00:00
Symptom	304000 Suspension System

Content Issue:

Red suspension warning light after engine start up. The Chassis Control Module (CHCM) will have DTC U3000-47 logged

Cause:

This is due to the CHCM performing an internal reset after engine start up. Root cause for the reset is not yet known.

Action:

The issue can be recovered by an ignition cycle.
Please do not replace the CHCM
Clear DTC's
Perform an ignition cycle> Re-Check DTC's and ensure the DTC and warning light has been removed.

anBhdHRicnM7MjAyMy0wNi0wNiQyMDowNDoxMS4xODRaOzEzN4yMjYyNDguMTE4Ow==