

Reference	SSM76018
Models	E-PACE / X540
Title	Jaguar Drive Control Fault With Diagnostic Trouble Codes (DTCs) Stored
Category	Driveability
Last modified	29-Jun-2023 00:00:00
Symptom	698298 Malfunction Indicator Lamp

Content

ISSUE:

Customers may report a change of Jaguar drive control to 'Comfort' mode, without driver input.

The below DTCs may be stored:

U0028-81: 'Vehicle Communication Bus A - invalid serial data received' stored in the Gateway Module (GWM).

U0001-87: 'High Speed CAN Communication Bus - missing message' stored in the Transmission Control Module (TCM).

It may also be reported that specific applications involving the GWM do not complete.

NOTE: GWM software part affected = K9C3-14F530-AA

CAUSE:

Software error.

ACTION:

If the 2 DTCs are present and the GWM software is on the above mentioned software part number then do NOT renew the ATCM in an attempt to rectify this concern. A TCM software update will soon become available to rectify this concern. This SSM will be updated to advise when the required TCM software update is available.

anBhdHRIcnM7MjAyMy0wNy0xMDFQxODoxMzoxNi4yODdaOzEzNi4yMjYyNDguODU7