



Bulletin No.: PIT6033
Published date: 06/21/2023


Preliminary Information

PIT6033 Diagnostic Tip - Clunk / Rattle / Squeak / Pop / Click Noise When Turning

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade Models	2021 - 2023	All	All	All	All
Chevrolet	Suburban	2021 - 2023	All	All	All	All
Chevrolet	Tahoe	2021 - 2023	All	All	All	All
GMC	Yukon Models	2021 - 2023	All	All	All	All

Involved Region or Country	North America
Condition	Some customers may comment on a clunk, pop, rattle, click, and/or squeak type noise from under the vehicle. In most cases, the noise can be duplicated when making full left and then full right turns, at slow speeds, in an open parking lot. This noise may sound like it is from the front of the vehicle, but it is coming from the rear.
Cause	The cause of this noise could be a loose rear sway bar link upper mounting bolt/nut, shown below.

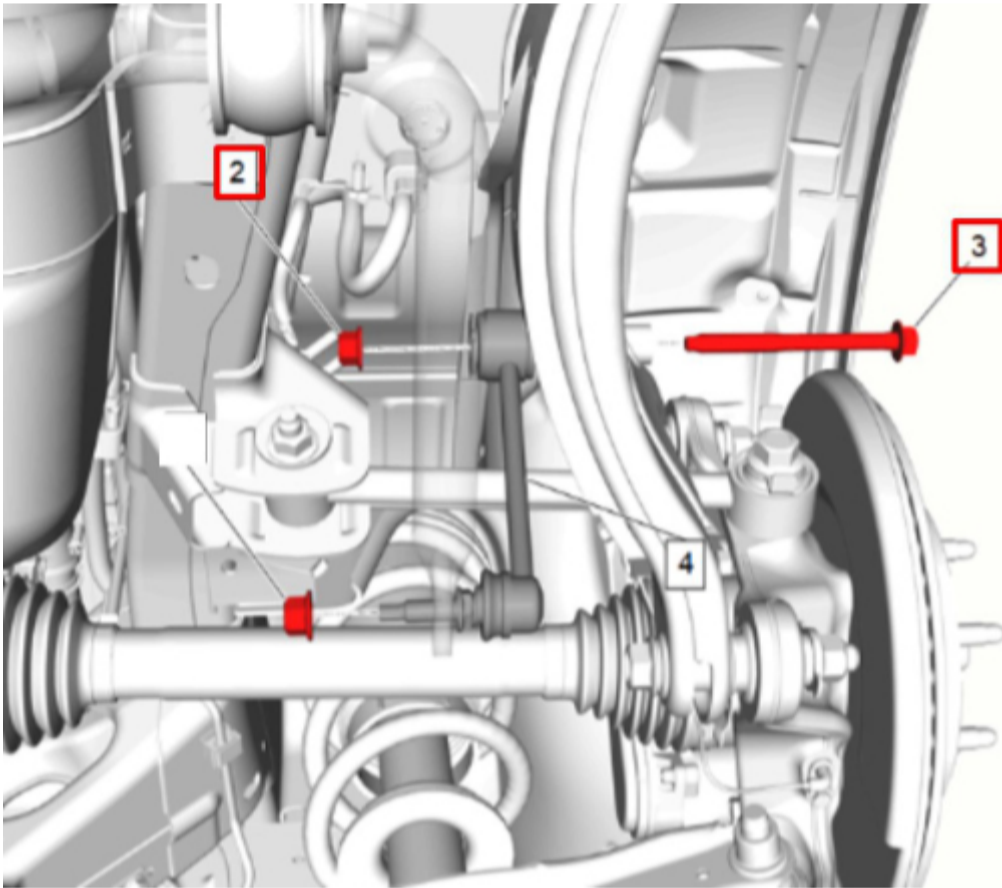

Correction:

Inspect the rear sway bar link upper mounting bolts/nuts for proper torque and if necessary torque to 74 lb. ft. (100 Nm).

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
8040550	Rear Stabilizer Shaft Link	Use Published Time

Version History

Version	1
Modified	06/21/2023 - Created on.



GENERAL MOTORS

© 2023 General Motors. All Rights Reserved.