



Preliminary Information

PIP5933 2024 Duramax 6.6L L5P DTC P060C

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 2500 and 3500	2024	All	All	6.6 L5P	All
GMC	Sierra 2500 and 3500	2024	All	All	6.6 L5P	All

Involved Region or Country:	North America. Israel, Palestine, Middle East
Condition:	Customer may have a concern of the MIL being illuminated.
Cause:	A technician may find one of two causes: #1. DTC P060C set with DTC C2A07 possibly found in history. #2. DTC P060C set along with DTCs P0090, P0092, P00C9, P12A6, P2294 and / or P2296.

Correction:

For cause #1, update the ECM with the latest calibration. This is likely a sequential update with the TCM. If there is no update available, refer to SI diagnostics.

For cause #2, if P060C is active, please turn off the ignition and allow the ECM to power down. Clear the code (s), then let the ECM power down again. If the concern returns, please replace the ECM. If the concern cannot be duplicated, Engineering is aware of the issue and is working on a solution.

Version History

Version	1
Modified	06/30/2023 - Created on.



GENERAL MOTORS