

RAPID UPDATE

FROM: Maserati TSO

TO: Maserati Network



MASTERS OF CARE

Rapid Update 625 MC20 – Traffic Sign Recognition (TSR) Update



DATE: JUNE 7 2023

Certain Maserati MC20 (M240) MY23 listed in MODISCS+ are involved in a Rapid Update to replace the LANE ASSIST CAMERA MODULE.

The LANE ASSIST CAMERA MODULE may have been installed with the incorrect market's "Traffic Sign Recognition" (TSR) configuration during production on certain vehicles. As a result, the accuracy of the TSR cannot be guaranteed. To rectify this issue, it is necessary to replace the LANE ASSIST CAMERA MODULE and recalibrate it using the EVO.

We remind you that all Rapid Updates must be performed at the first entry of the vehicle into the workshop, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for cars in Stock Dealer / PDI, it is necessary to perform all the Update operations before delivery to the end customer, as prescribed by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before starting the procedure.
Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions. (Maseratitechsupport@maserati.com)

Thank You for your continued support and cooperation.

Maserati Americas
Aftersales Dept.

Procedure

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. Open the front hood and remove the battery compartment cover according to the workshop procedures:
 - **09.61.103 - LUGGAGE COMPARTMENT RH SIDE COVER - Removal/refitting or replacement**
3. Disconnect the battery by following the appropriate procedure in the workshop manual:
 - **8.20.001.0 BATTERY Electrical supply connection – disconnection**
4. Once the battery is disconnected, it is possible to replace the LANE ASSIST CAMERA MODULE by following the relative procedure in the workshop manual:
 - **8.71.226 LANE ASSIST CAMERA MODULE - Removal/refitting or replacement**
5. Once the module replacement is complete, use the EVO, perform a proxy alignment, and proceed to calibrate the camera module by following the procedure in the workshop manual:
 - **BCM → Procedure → Proxy alignment**
 - **08.71.226 - LANE ASSIST CAMERA MODULE - Recording and testing with diagnostic tester**
6. Perform a functional test.
7. Re-install all removed components in reverse order following the workshop manual.
8. Procedure complete.

Spare Parts

To proceed order the following spare parts:

Spare parts	PN	QTY
LANE ASSISTANT CAMERA MODULE	670179012	1

Warranty claim

Complete your warranty claim as follows:

Description	Code
Rapid Update Number	625
Warranty code	23
Error code	063
Part Code	8.71.226
Operation Code ▪ Rework	8.71.226.A (0,75 h)