

9100143

05/02/2023

MY19-23 DT, 22-23 VF 18-23 JL
18-23 RU 18-22 WK 21-23 WL 20-
23 JT 22-23 WS 22-23 W4 18-23
WD

GPOP - Issue Review System

Part Number: 05047913A\$

Part Description: PSU right intake camshaft

Issue Description: Case 1) If you are to flash the PSU (Pentastar Upgrade Engine) PCM due to P0300 code presence, only AB or previous LEVEL PSU right intake camshaft PN 05047913AA or AB (old version) should be replaced. If the engine is equipped with the AC/AD LEVEL PSU right intake camshaft PN 05047913AC or AD (new version), camshaft should NOT be replaced.

Case 2) If the intake camshaft or intake rocker arm has excessive wear on the high lift profile (Rocker arm: slider, Camshaft: central lobe), replace the intake camshaft (1) in that cylinder head and all intake rocker arms (6).