

Technical Service Bulletin (TSB)
Water Leak - Liftgate Glass to Swing Gate

REFERENCE:	TSB: 23-049-23 GROUP 23 - Body	Date:	May 2, 2023	REVISION:	—
VEHICLES AFFECTED:	2022 - 2023 (JL) Jeep Wrangler This bulletin applies to vehicles built on and after August 1, 2022 (MDH 0801XX) and on and before October 8, 2022 (MDH 1008XX) equipped with Black Three Piece Hard top (Sales Code HT1) or Body Color Three Piece Hard top (Sales Code HT3).	MARKET APPLICABILITY:			
		<input checked="" type="checkbox"/> NA	<input checked="" type="checkbox"/> CH	<input checked="" type="checkbox"/> EE	<input checked="" type="checkbox"/> IAP
		<input checked="" type="checkbox"/> SA	<input checked="" type="checkbox"/> MEA		
CUSTOMER SYMPTOM:	Water leak into rear cargo area at the bottom of lift glass seal and top of swing gate.				
CAUSE:	Body fit and dimensional variation.				

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 23-120, date of issue May 2, 2023. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty. This RSU will expire 18 months after the date of issue.

REPAIR SUMMARY:

This bulletin involves installing two pieces of foam pads.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
23-51-43-93	Install Foam Pads on Swing Gate (1- Semi-Skilled)	6 - Electrical and Body Systems	0.2 Hrs.
Failure Code	ZZ	Service Action	

SPARE PARTS:

Qty	Part No.	Description	Notes
2 (AR)	68053426AA	Foam Rectangle	

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RSU VIN list, perform the repair. If any vehicle not on the VIN list exhibits any of the symptoms listed above in the customer symptom section, perform the Repair Procedure.

REPAIR PROCEDURE:

1. Clean the surface area that the foam is being applied to with an alcohol wipe (Fig. 1) .
2. Install foam pads on rear swing gate (Fig. 2) , (Fig. 3) .



Fig. 1
Foam Pad Area



Fig. 2
Foam Pad Installed



Fig. 3
Foam Pad Installation Complete

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.