

HANDS-FREE ACCESS Inoperative

Topic number	LI80.61-P-076702
Version	1
Function group	80.61 - Keyless-Go/Keyless-Entry
Date	7/14/23
Validity	C254 GLC Coupe AMG Line exterior (P31)
Reason for change	

Complaint

Trunk lid cannot be opened and closed with HANDS-FREE ACCESS (HFA). In the EZS control unit (N73), the fault code B1F8C14 ("The top sensor of the rear switch module has malfunctioned. There is a short circuit to ground or an open circuit. (HFA223)") is stored.

Cause

Coding in control unit N38 (HANDS-FREE ACCESS).

Remedy

Perform SCN coding in control unit N38.

Symptoms				
Overall vehicle > Safety and locking system > Keyless go > Function > Vehicle does not open				
Control unit/fault code				
Control unit		Fault text		
N73/3 - Electronic ignition lock (EZS) (EZS223)		B1F8C14 - The upper sensor of the rear switching module has a malfunction. There is a short circuit to ground or an open circuit. (HFA223)		
Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			8000G	Fault type: 90