



Service Bulletin

Bulletin No.: 23-NA-132

Date: August, 2023

TECHNICAL

Subject: Turn Signals and/or Daytime Running Lights Intermittently Inoperable

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Silverado 2500HD/3500HD	2024	2024	SOP	April 1, 2023	—	—

Involved Region or Country	North America
Condition	Some customers may comment that the turn signals or Daytime Running Lights (DRL) are intermittently inoperable. It may correct itself after the vehicle is shut down and restarted. There may also be a message illuminated in the DIC stating Service the Headlamps.
Cause	The cause of the condition may be a software issue in the headlamp assembly.
Correction	Do Not replace the Exterior Lighting Module (ELM). Headlamp parts have been updated, replace the headlamps. Refer to <i>Front Headlamp Replacement</i> in the Service Manual.

Service Procedure

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Parts Information

Causal Part	Description	Part Number	Qty
X	HEADLAMP ASM-FRT	86514717	1
X	HEADLAMP ASM-FRT	86514718	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2040510	Front Headlamp Replacement	Use Published Labor Operation Time

Version	1
Modified	Released July 26, 2023

