



GROUP	MODEL
Service Campaign	2023MY Telluride (ON)
NUMBER	DATE
SC274	August 2023

## VOLUNTARY SERVICE CAMPAIGN

### POSITIVE BATTERY TERMINAL NUT RE-TIGHTENING (SC274)

SUBJECT:

This bulletin provides information to re-tighten the positive (+) battery terminal nut on certain 2023MY Kia Telluride (ON) vehicles produced from February 8, 2023 through May 22, 2023. The positive (+) battery terminal nut may not have been properly tightened during assembly. If the battery terminal nut is not properly tightened, it may loosen over time, resulting in illumination of "Charging System Warning Light. Before conducting the procedure, verify that the vehicle is included in the list of affected VINs.




#### NOTICE


Repair status for a VIN is provided on KDealer+ (Service → Warranty Coverage → Warranty Coverage Inquiry → Campaign Information). Not completed Recall / Service Action reports are available on KDealer+ (Consumer Affairs → Not Completed Recall → Recall VIN → Select Report), which includes a list of affected vehicles.

**Repair Procedure:**

1. Open the hood and disconnect the battery negative (-) terminal (A).

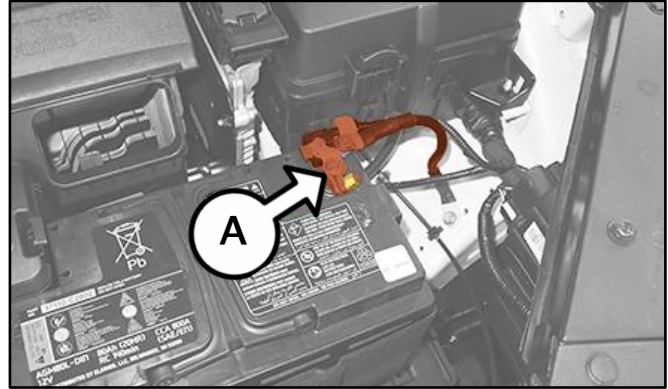


2. Detach/open the battery positive (+) terminal cover (B).

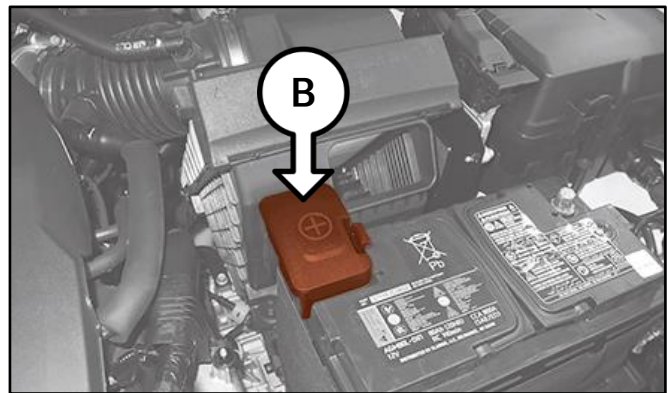

3. Confirm that the positive (+) terminal nut (C) shown is secured and tightened to specification:



Tightening torque for nut (C):  
86.8 - 104.1 lb.in. (9.8 - 11.8 N.m)

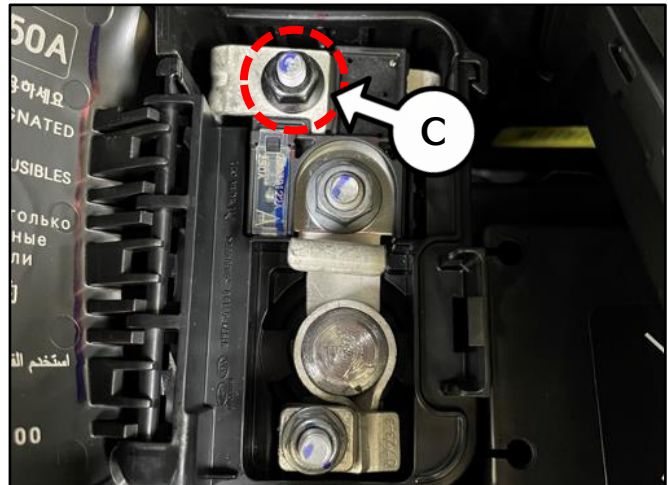

4. Reinstall all removed parts in the reverse order of removal.
5. Confirm normal operation.

SUBJECT:

**POSITIVE BATTERY TERMINAL NUT RE-TIGHTENING (SC274)****AFFECTED VEHICLE RANGE:**

Model	Production Date Range
Telluride (ON)	February 8, 2023 to May 22, 2023

**REQUIRED TOOL:**

Tool Name	Part Number	Figure	Comments
Torque Wrench	N/A	N/A	Locally Sourced

**WARRANTY INFORMATION:****N Code: N99 C Code: C99**

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
R	37180 S9500	0	(SC274) Positive Battery Terminal Nut Re-Tightening	230A21R0	0.2 M/H	N/A	0

**NOTICE**

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference **SC274** when accessing the KDealer+ system.

