

MAS003708 RU 23-34

RAPID UPDATE

FROM: Maserati TSO

TO: Maserati Network



Maserati

PERSONAL SERVICE LAB

MASTERS OF CARE

Rapid Update 641 M15X-M161 – ICS Software Update



DATE: JULY 19 2023

Certain Maserati Ghibli (M157), Levante (M161), and Quattroporte (M156) MY22 MY23 listed in MODISCS+ are involved in a Rapid Update concerning the Integrated Center Stack (ICS) software update.

The new software strategy solves the volume not operating by the rotary knob command and the A/C control panel not working.

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before starting the procedure.

Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions. (Maseratitechsupport@maserati.com)

Thank You for your continued support and cooperation.

Maserati Americas
Aftersales Dept.

Procedure

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. Before proceeding, please ensure that the Engine is OFF.
3. Connect the MD EVO to the VCI2 using the USB cable.
4. Connect the VCI2 to the vehicle.
5. Key ON Engine OFF (KOEO) check battery voltage and ensure it is 12V or above. Please use a battery maintainer to maintain a stable power supply (e.g., E-XTEQ charger Tester)
6. With the MD EVO select **ICS ► ECU Programming** and follow the prompts.
7. Procedure complete.

Software to be installed (or newer)

| ECU | F122 New | SW New |
|-----|-----------|----------|
| ICS | 670306259 | 23.13.07 |

Warranty Claim

Fill in the relative Warranty Claims as follows:

| Description | Code |
|---------------------|--------------------|
| Rapid Update Number | 641 |
| Warranty Code | 23 |
| Fault Code | 063 |
| Component Code | 8.71.240 |
| Operation Code | |
| ▪ M156 | 8.71.240.B (0,20h) |
| ▪ M157-M161 | 8.71.240.A (0,20h) |