

 Tesla, Inc. Service Bulletin		<h2 style="margin: 0;">Retrofit Front Doors With Updated Latches</h2>	
SB-16-11-006 June 02, 2023		R3	
Classification Campaign Bulletin		Section/Group 11 - Closures	Mobile Service Cannot Perform
Model Year 2015 - 2016		Model Model X	Country/Region All
		Build Location Fremont	
<small>The model(s) and model year(s) listed are a general approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.</small>			

Campaign Bulletin: This campaign bulletin addresses a non-safety-related condition and provides recommended technical diagnosis and repair procedures. Apply this procedure to the applicable vehicles.

This Service Document supersedes SB-16-11-006 R2, dated February 5, 2019. This new revision, R3, updates the link to information to determine the door latch version, and FRT time. Each content change is marked by a vertical line in the left margin. Discard the previous version and replace it with this one.

Condition

Early front door latches are susceptible to water ingress, which might cause the touchscreen to show the door in the wrong position or prevent the door from opening and closing automatically. The door can still be opened with the inside handle.

Correction

Direct replacement latches are no longer available. Retrofit the LH and RH front doors with updated latches.

⚠ CAUTION: Attempting to close a front door with the wrong striker installed could result in damage to the front door latch.

📖 NOTE: To determine the vehicle door latch version and for additional information, refer to "[Front Door and Front Door Latch Replacement](#)" within the Model X (2015-2020) Collision Repair Procedures.

Correction Description	Correction	Time
SB-16-11-006 Not Applicable	S011611006	0.00
Retrofit LH And RH Front Doors With Updated Latches	S041611006	3.36

Part Number	Description	Quantity
Parts Required 1446159-00-C	LATCH RETROFIT KIT LH AND RH, SERVICE	1

These part numbers were current at the time of publication. Use the revisions listed or later, unless otherwise specified in the [Parts Catalog](#).

Procedure

Retrofit the LH and RH front doors with updated latches (refer to Service Manual procedure [11351506](#)).