



STAR ONLINE PUBLICATION



Case Number: S2321000006

Release Date: June 2023

Symptom/Vehicle Issue: Service Transmission Message Illumination. Diagnostic Trouble Code (DTC) P0700-E4 – Transmission Control System (MIL Request), Set.

Discussion: Some customers may experience a MIL illumination. Upon further investigation, the technician may find DTC P0700-E4 setting in the Powertrain Control Module (PCM). This will be the only DTC that is set.

When searching Service Library for DTC P0700-E4, it may be noticed that there are no specific diagnostic flow charts for the DTC “E4” subcode. This is due to the current Transmission Control Module (TCM) software causing the DTC to be reported incorrectly to the scan tool.

NOTE: The most common cause of P07E4-00 is the Manual Park Release (MPR) being activated prior to, or after the shifter is placed into park.

If the technician is working on the vehicle with the above DTC, please follow normal published diagnostics for DTC P07E4-00 – Unable To Engage Park, and repair as necessary.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechConnect, eCONTACT or Service Library entry if no solution is found.