



STAR ONLINE PUBLICATION




Case Number: S2308000066 Rev. B

Release Date: June 2023

Symptom/Vehicle Issue: Dome Lamp, Ultrasonic Antitilt Module (UAM), Alarm Siren Unit (ASU) Inoperative After a Recent Module Flash

Technician Observation: Dome lamps do not turn on as expected, security warning lamp on, or Diagnostic Trouble Codes (DTC's) U1413-09, U1413-87 for UAM or U1412-09 for ASU.

Discussion: If the dome lamps do not operate after a recent service repair/module flash or the vehicle has the above DTCs. Use the scan tool to perform a Body Control Module (BCM) reset. Use the **wiTech select > Guided Diagnostics > Reset ECU > BCM**. Check the operation, if the dome lamps are still inoperative, perform a momentary battery disconnect and without delay reconnect the battery. No parts required, test the operation to complete.

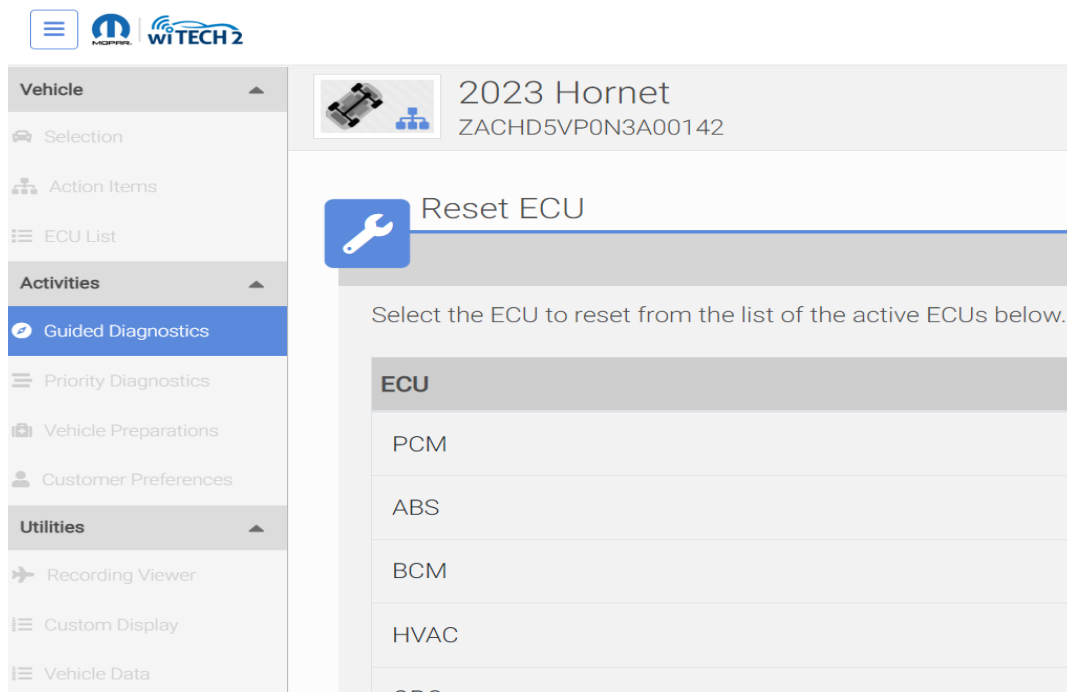

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found