



## STAR ONLINE PUBLICATION




**Case Number: S2308000076**

**Release Date:** June 2023

**Symptom/Vehicle Issue:** Anti-lock Brake System (ABS), Electronic Stability Lamp (ESC) Warning Lamps on, No Start, Decrease in Steering Assist “Service Steering System Message”

**Customer Complaint/Technician Observation:** Owner complains of cluster warning lamps that are on for the ABS and ESC, a no start or lack of steering assist after a recent service repair. Technician observed the vehicle may be setting Diagnostic Trouble Codes (DTCs) U3006- Control Module Power Input Circuit A Open, U3007- Control Module Power Input Circuit B Open, C2100- Battery Voltage Low.

**Repair Procedure:** Inspect the C2 Power Distribution Center 60-way black connector. Review for spread or pushed out terminals using the push-pull-push method to secure all circuit terminals for proper connections. No parts required Fig 1 and 2.

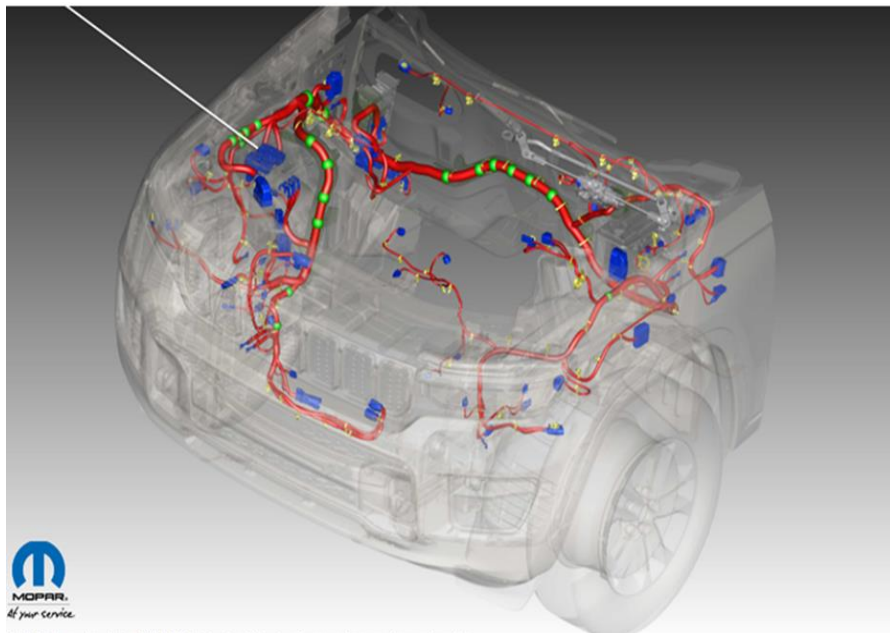

**Fig 1**

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.


**Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found**




## STAR ONLINE PUBLICATION



### Use push-pull-push method to secure circuit push outs

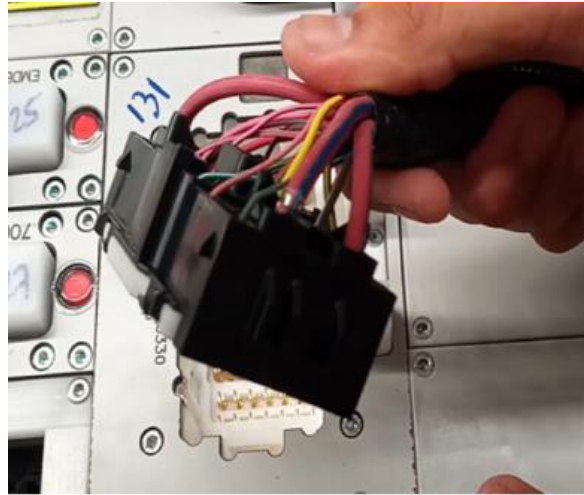

### Review for spread terminals

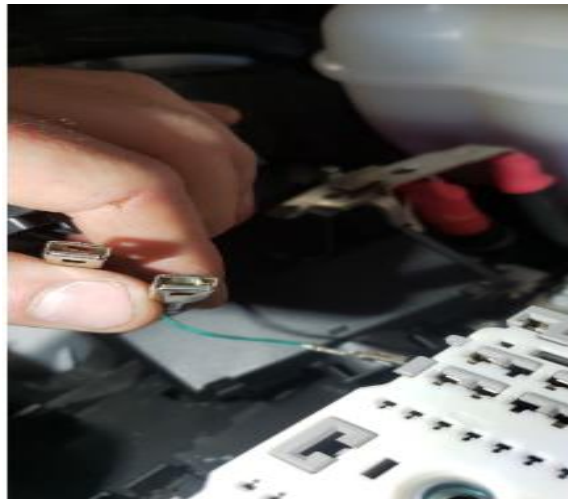

**Fig 2**

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

**Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found**