



STAR ONLINE PUBLICATION



Case Number: S2308000077

Release Date: June 2023


Symptom/Vehicle Issue: Cluster Displays “Lamp Out” Message After a Recent Repair or Headlamp Service Replacement

Technician Observation: The turn signals operate; however, the Instrument Panel Cluster (IPC) displays a “Lamp Out” message. The vehicle may set Diagnostic Trouble Codes (DTCs) B163A-15 Front Left Turn Lamp 1 Control-Circuit Short to Battery or Open, B163A-11-Front Left Turn Lamp Control-Circuit Short to Ground.

Discussion: Vehicles equipped with LED turn signals assemblies require sales code LPU (LED Turn Signals). Inspect the part number(s) of the installed turn signal lamp assemblies, if lamp part numbers installed are 68433784A\$ and 68433785A\$, review the LED Turn Signal Lamps Present setting under the vehicles configuration to ensure the feature is (Set).

If the above headlamp part numbers are present and the setting is showing (Not Set), verify the vehicle has sales code LPU and perform the restore vehicle configuration to ensure the LED Front Turn Lamps Present are (Set). Test the operation to complete.

Below is an example of the configuration showing the LED Front Turn Lamps Present - (Not Set).

LED License Lamps Present	Set
LED Front Turn Lamps Present	Not Set 
LED Front Fog Lamps Present	Not Set

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found