

REFERENCE:	TSB: 23-074-23 GROUP 23 - Body	Date:	June 21, 2023	REVISION:	-
VEHICLES AFFECTED:	2019 - 2021 (DT) RAM 1500 Pickup This bulletin applies to all vehicles built on or after October 01, 2017 (MDH 1001XX) and prior to December 31, 2020 (MDH 1231XX) equipped with a Cargo And CHMSL Lamp (Sales Code LPE).			MARKET APPLICABILITY:	
				<input checked="" type="checkbox"/> NA	<input type="checkbox"/> CH
				<input checked="" type="checkbox"/> EE	<input checked="" type="checkbox"/> IAP
				<input checked="" type="checkbox"/> SA	<input checked="" type="checkbox"/> MEA
CUSTOMER SYMPTOM:	Customers may experience one or more of the following: <ul style="list-style-type: none"> • Water on the headliner. • Water at the back of the cab. • A leak from the third brake/cargo light/CHMSL. 				
CAUSE:	Degradation of the gasket material.				

REPAIR SUMMARY:

This bulletin involves replacing the CHMSL assembly.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
08-50-88-93	Lamp, Center High Mounted Stop Replace (0 - Introduction)	6 - Electrical and Body Systems	0.3 Hrs.
Failure Code	ZZ	Service Action	

SPARE PARTS:

Qty	Part No.	Description	Notes
1	68298380AH	Lamp Center High Mounted Stop	Bulb CHMSL

DIAGNOSIS:

If the customer describes any of the symptom listed above in the customer symptom section, perform the Repair Procedure.

REPAIR PROCEDURE:

1. Replace the CHMSL assembly. Refer to the detailed service procedures available in DealerCONNECT> Service Library under: Service Info>08 Electrical / 8L Lamps and Lighting / Lamps/Lighting Exterior / Lamp, Center High Mounted Stop / Removal and Installation.

NOTE: Ensure the interior is dry before returning the vehicle to the customer.

POLICY:

Vehicles included in this Technical Service Bulletin have a warranty extension to an 10 Year/150,000 miles from in service date warranty period for this repair. See Warranty Bulletins: U.S. D-23-11, Canada SAB 2023-17, International ID-23-14, Puerto Rico/U.S. Virgin Islands ID-23-13 and Mexico BG-02-23, for details associated with the Warranty Extension.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.