

REFERENCE:	TSB: 08-043-23 REV. A GROUP 08 - Electrical	Date:	June 30, 2023	REVISION:	08-043-23
VEHICLES AFFECTED:	2020 - 2022 (BV) Jeep Renegade This bulletin applies to vehicles built on or after August 25, 2020 (MDH 0825XX) and built on or before March 14, 2022 (MDH 0314XX) equipped with 1.3L I4 Turbo PHEV Engine (Sales Code EYG) and Auto Power Folding Mirrors (Sales Code LFF).	MARKET APPLICABILITY: <input type="checkbox"/> NA <input checked="" type="checkbox"/> MEA <input type="checkbox"/> SA <input checked="" type="checkbox"/> **IAP** <input checked="" type="checkbox"/> EE <input type="checkbox"/> CH			
CUSTOMER SYMPTOM:	The customer may describe the power folding mirrors may intermittently not power fold or unfold.				
CAUSE:	<ul style="list-style-type: none"> Folding mirror switch. 				

This bulletin supersedes Technical Service Bulletin (TSB) 08-043-23, date of issue February 08, 2023, which should be removed from your files. All revisions are highlighted with ****asterisks**** and include additional markets.

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 22-178, date of issue October 01, 2022. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/ Service Library. All repairs are reimbursable within the provisions of warranty. This RSU will expire 18 months after the date of issue.

REPAIR SUMMARY:

This bulletin involves replacing the power folding mirror/window switch assembly on the door.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
08-80-54-95	Switch and Bezel, Front Door - Replace (1 - Semi-Skilled)	6 - Electrical and Body Systems	0.2 Hrs.
Failure code	ZZ	Service Action	

SPARE PARTS:

Qty	Part No.	Description	Notes
1 (AR)	7MS28LXHAA Mopar 735768399 Enlarged Europe	Switch, Power Folding	(Right Hand Drive)
1 (AR)	7MS33LXHAA Mopar 735768403 Enlarged Europe	Switch, Power Folding	(Left Hand Drive)

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RSU VIN list, perform the repair. If any vehicle not on the VIN list exhibits any of the symptoms listed above in the customer symptom section, perform the Repair Procedure.

REPAIR PROCEDURE:

NOTE: High Voltage power down is not needed for this repair.

1. Replace the driver's door switch assembly. Refer to the detailed service procedures available in DealerConnect> Service Library under: Service Info> 08 - Electrical / 8N - Power Systems / Power Windows / Switch, Power Window / Removal and Installation.

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.