

## Trunk Lid/Tailgate Unlocks But Does Not Open

---

Topic number	LI72.20-P-075232
Version	4
Function group	72.20 - Tailgate, rear door
Date	8/17/23
Validity	MODEL 206 with code 881 or 890 up to manufacturing date June 30, 2023. MODEL 295 with code 881 up to manufacturing date June 30, 2023. MODEL 254 up to manufacturing date June 30, 2023. MODEL 294 up to manufacturing date June 30, 2023. MODEL 296 up to manufacturing date June 30, 2023. MODEL 297 up to manufacturing date June 30, 2023. MODEL 232 up to manufacturing date June 30, 2023.
Reason for change	Validity extended

---

### Complaint

When operating a control point to open the trunk lid or the tailgate, the trunk lock unlocks, but there is no actuation of the trunk control/tailgate control drive unit (M51/3).

### Cause

Faulty microswitch signal of trunk lock.


In the event of a problem, the status of the trunk lock (picture 1) does not change during opening/closing of the trunk lid or tailgate.

The function of the interior trunk release is not affected.

XENTRY Diagnosis COM Kit path: XD > HKS/KDS CU (N121/1) > ACTUAL values > Status of trunk locka

Attachments	
File	Description
<a href="#">XENTRY+Still.png</a>	XENTRY Diagnosis - Status of Trunk Lock

# XENTRY TIPS

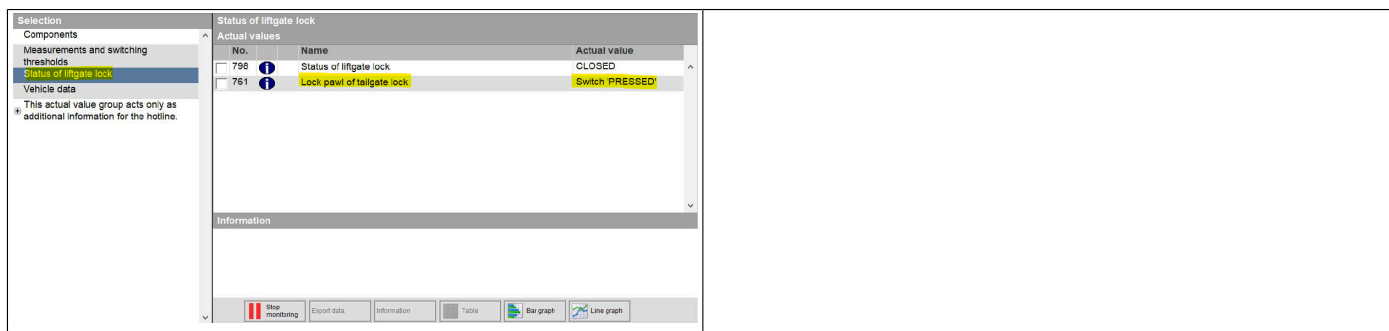

## Remedy

Replace trunk lock (A85/5).

WIS-References		
Document number	Title	Note
AR72.20-P-1022EQS	Remove/install liftgate latch	Model 294, 296, 297
AR72.20-P-1022WT	Remove/install liftgate latch	Model 206.2, model 254
AR88.50-P-0003EQE	Remove/install trunk lid lock	Model 295
AR88.50-P-0003WT	Remove/install trunk lid lock	Model 206.0/1

Symptoms
Body > Door/Flap > Hood/flap > Trunk lid/liftgate > Does not open

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			7501173	Trunk lid trunk lock
			7431173	Tailgate trunk lock