



Volvo Car USA LLC

Technical Journal

Technical Journal Title LR PHEV BECM Software Improvements		Ref. No. TJ 36681.3.0	
Issuer (Dept.) Technical Service		Issue Date 7/5/23	Status Date 7/17/23
Car Market United States and Canada	Partner 3 US 7510 Volvo Car USA	Function Group 3113	
Function Description Battery, high voltage		Page Page 1 of 2	

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

DESCRIPTION:

*VST updated

*Structure week updated

If the customer experiences a Check Engine light and one or more of the DTCs (Diagnostic Trouble Codes) mentioned in this TJ are confirmed, follow the instructions under “Service.”

CSC Customer Symptom Codes

Code	Description
7G	Text window and warning symbol/Yellow symbol and text message

DTC Diagnostic Trouble Codes

Control Module	Code	Fault Type
BECM	POC3200	Permanent
BECM	POD1F62	Permanent
BECM	PODAF00	Permanent
BECM	PODB300	Permanent
BECM	PODB700	Permanent

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
224	H6	BH6PHEV					2022-2023		-	202147-202317
225	H6	BH6PHEV					2022-2023		-	202147-202317
235	H6	BH6PHEV					2022-2023		-	202147-202317
238	H6	BH6PHEV					2022-2023		-	202147-202317
246	H6	BH6PHEV					2022-2023		-	202147-202317
256	H6	BH6PHEV					2022-2023		-	202147-202317

SERVICE:

Important! Follow Quality Bulletin A10241 if applicable. If QB A10241 does not apply, please follow the steps below.

Do not replace any parts.

Improved BECM (Battery Energy Control Module) software was released in 2023 Week 25 / Version 2.10 to solve misdetection.

Perform a total upgrade of the software according to TJ 31543.

Note: If BECM POD1F96 appears after the total upgrade, let the car go to sleep in order to re-sync the timers in the software. (Disconnect from VIDA, close all doors and the hood, lock the vehicle, and let it sit undisturbed for at least 15 minutes.) Afterward, erase the DTC.

Warranty claim info:

To get a warranty claim accepted for a job described in this TJ, use the corresponding VST OP number stated in this TJ.

Note that the TJ number must be stated in the repair order text.

VST Operation Number

VST Operation Number	Description
36002-3	Additional Software control module downloading
36001-2	Diagnostic trouble codes read / reset / known Diagnostic trouble codes with VIDA

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use the concern area "Vehicle Report" and sub-concern area "Support Needed," use function group 3113.